


PB98-110034



APPENDIX D. SAMPLING AND ANALYSIS

JUL 97

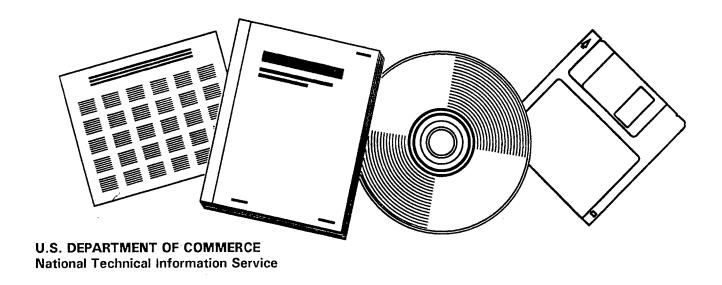

APPENDIX D



PB98-110034

SAMPLING AND ANALYSIS

Report No. MA-ENV-820-96003-D Contract No. DTMA91-93-C-00004



Maritime Administration

JULY 1997

LEGAL NOTICE

This report was prepared as an account of government-sponsored work. Neither the United States nor the Maritime Administration, nor any person acting on behalf of the Maritime Administration (A) Makes any warranty or representation, expressed or implied, with respect to the accuracy, completeness or usefulness of the information contained in this report, or that the use of any information, apparatus, method, or process disclosed in this report may not infringe privately owned rights; or (B) Assumes any liabilities with respect to the use of or for damages resulting from the use of any information, apparatus, method, or process disclosed in this report. As used in the above, "persons acting on the behalf of the Maritime Administration" includes any employee or contractor of the Maritime Administration to the extent that such employee or contractor prepares, handles, or distributes, or provides access to any information pursuant to his employment or contract with the Maritime Administration.

50272-101			- PB98-110034
REPORT	1. REPORT NO.	2.	
DOCUMENTATION PAGE	MAR-ENV-820-96003-D		
4. Title and Subtitle Appendix D			5. Report Date July 1997
Sampling and Analysis Repo	ort		6.
			, o.
7. Author(s)			8. Performing Organization Rept. No.
			g enganeau nepu ne
9. Performing Organization Name	and Address		10. Project/Task/Work Unit No.
Halliburton NUS Corp.			
910 Clopper Rd.			11. Contract(C) or Grant(G) No.
Gaithersburg, MD 20878			
			(C) DTMA91-93-C-00004
			(G)
12. Sponsoring Organization Name			13. Type of Report & Period Covered
United States Maritime Adm Office of Environmental Acti			Final
Washington, DC 20590	vittes		14.
vvdomington, DO 20000			February 1995-July 1997
15. Supplementary Notes			
16. Abstract (limit: 200 Words)	Particular de la constitución de		
	LENGER, SHIRLEY LYKES and WAY		
	Virginia, were sampled for potential	ly hazardous materials tha	at are subject to environmental,
safety and health regulations	š.		
Samples of electrical cables.	ventilation system gaskets and asso	orted nonmetallic materials	s, such as rubber and caulking.
	d for polychlorinated biphenyls (PCB		
(ppm), by weight, were foun	nd in all types of the materials that v		
varied from ship to ship.			
Complex of thermal inculation	n noint footonore refrigerente and	athar matarialaara raas	
	n, paint, fasteners, refrigerants, and zardous constituent. All three ships		
levels of asbestos in thermal	insulation, cadmium plating on fast	eners, and ethylene glycol	l as antifreeze. These results
	fety and health controls will be requ		
	roblems with regard to PCBs and oth		
			ŀ
17. Document Analysis a. Descrip	oters		
Ship Breaking/Recycling			
PCBs			
Hazardous Materials			
		•	
b. Identifiers/Open-Ended Terms			
			;
c. COSATI Field/Group			
18. Availability Statement	-	19. Security Class (Thi	is Report) 21. No. of Pages
Approved for Release		Unclassified	21. No. of Pages
National Technical Information	on Service	20. Security Class (Thi	s Page) 22. Price
Springfield, VA 22161		Unclassified	

Appendix D

Sampling and Analysis

Report No. MA-ENV-820-96003-D Contract No. DTMA91-93-C-00004



Maritime Administration

			·	
		,		

TABLE OF CONTENTS

EXEC	UTIVE SUMM	ARY ES-1
1.0	INTRODUCTION 1.1	ON
2.0	SAMPLING . 2.1.1 2.2	PCB SAMPLING DESIGN
3.0	ANALYSIS 3.1 3.2	PROCEDURES 13 DIFFICULTIES 14
4.0	RESULTS 4.1 4.1.1 4.1.2 4.1.3 4.1.4 4.2 4.2.1 4.2.2 4.3 4.3.1 4.4.1	ELECTRIC CABLES Cable Construction Cable Analysis Cable Analysis Results Evaluation of Visually Identical Cable Groups VENTILATION SYSTEM GASKETS Casket Materials Gasket Sampling Results OTHER PCB MATERIALS Material Categories NON-PCB SAMPLES Materials and Results 31 Materials and Results
5.0	CONCLUSION	IS 37
REFEI	RENCES	
APPE	NDIX 1 Descrip	otion of Cable Samples

LIST OF TABLES AND FIGURES

TABLES

Table 1.	Features of SHIRLEY LYKES and USS TICONDEROGA
Table 2.	Gross Weight, Strata Quota, and Number of Samples Collected
Table 3.	Samples Taken from Each EXPORT CHALLENGER Deck
Table 4.	Samples Taken from Each SHIRLEY LYKES Deck
Table 5.	Samples Taken from Each WAYNE VICTORY Deck
Table 6.	Cable Samples
Table 7.	Ventilation Gasket Samples
Table 8.	Categories for Other PCB Materials
Table 9.	Summary of Results of EXPORT CHALLENGER Cable Sampling 21
Table 10.	Summary of Results of SHIRLEY LYKES Cable Sampling
Table 11.	Summary of Results of WAYNE VICTORY Cable Sampling 23
Table 12.	Analysis of Duplicate Cables
	EXPORT CHALLENGER Ventilation System Gaskets Sampling Results 26
Table 14.	SHIRLEY LYKES Ventilation System Gaskets Sampling Results
Table 15.	WAYNE VICTORY Ventilation System Gaskets Sampling Results 28
Table 16.	EXPORT CHALLENGER - Other PCB Sample Results
	SHIRLEY LYKES - Other PCB Sample Results
	WAYNE VICTORY - Other PCB Sample Results
Table 19.	EXPORT CHALLENGER Non-PCB Samples
	SHIRLEY LYKES Non-PCB Samples
Table 21.	WAYNE VICTORY Non-PCB Samples
<u>FIGURES</u>	
Eigung 1	Tymical Cargo Shin
	Typical Cargo Ship
	Typical Electric Cable
rigure 3.	Process for the Selection of Cables for Further Analysis
rigure 4.	Key for Column Headings, Tables 9-11 and 13-18

EXECUTIVE SUMMARY

Three ships, EXPORT CHALLENGER, SHIRLEY LYKES and WAYNE VICTORY, in the Maritime Adminstration's James River Reserve Fleet at Fort Eustis, Virginia, were sampled for potentially hazardous materials that are subject to environmental, safety and health regulations.

Samples of electric cables, ventilation system gaskets and assorted nonmetallic materials, such as rubber and caulking, were recovered and analyzed for PCBs. PCBs at concentrations up to 18,900 parts per million, by weight, were found in all types of the materials that were sampled, but the types of materials with PCBs present varied from ship to ship. In WAYNE VICTORY, for example, no PCBs were found in electric cables but very high levels were found in ventilation system gaskets, while in EXPORT CHALLENGER, PCBs were found in both electric cables and gaskets. The types of materials used in each ship also varied. In SHIRLEY LYKES, for example, four kinds of materials were found in service as ventilation system gaskets and three contained PCBs, while in EXPORT CHALLENGER, seven kinds were found (only one appearing similar to a SHIRLEY LYKES material), two of which were contaminated with PCBs. No pattern emerged that was typical of all three ships.

Samples of thermal insulation, paint, fasteners, refrigerants, and other materials were recovered, and each sample was analyzed for one possible hazardous constituent. Thermal insulation samples, for example, were analyzed for asbestos, while fasteners were analyzed for evidence of cadmium plating, and antifreeze solutions for evidence of ethylene glycol. All three ships showed the same patterns of potential hazards, with high levels of asbestos in thermal insulation, cadmium plating on fasteners, and ethylene glycol as antifreeze.

These results show that environmental, safety and health controls will be required during breaking and recycling of these ships and that each ship presents unique problems with regard to PCBs and other potential hazardous materials.

This Page Intentionally Left Blank

1.0 INTRODUCTION

This report and its References 1 through 8 are part of a technical environmental evaluation of ship breaking/recycling technologies in the United States, the purpose of which is to provide to the U.S. Maritime Administration (MARAD):

- A survey of hazardous substance contamination problems encountered when breaking typical MARAD vessels, accomplished through appropriate testing and analysis of candidate ships;
- A survey of currently available and advanced technologies for effective removal, handling and disposal of hazardous materials resulting from ship breaking/recycling;
- A survey of current federal, state and local environmental laws and regulations applicable to ship breaking/recycling;
- A baseline economic case for cost-effective ship breaking/recycling in the United States; and
- An environmental assessment for government ship breaking/recycling activities in the United States that satisfies National Environmental Policy Act (NEPA) requirements.

This document addresses the first of these items, reporting the results of sampling and sample analysis for three ships in MARAD's James River Reserve Fleet, Fort Eustis, Virginia. Another report, "Survey of Ships and Materials" (Reference 5), evaluates the data and identifies practical ways to remove, during ship breaking/recycling, the hazardous materials identified by the sampling and analysis.

1.1 BACKGROUND

Three retired cargo ships were selected by MARAD for the sampling and analysis program.

• EXPORT CHALLENGER was built in 1963 for MARAD by the Sun Shipbuilding & Drydock Company, Chester, Pennsylvania. This is a three-deck, general cargo ship having a light ship displacement¹ of 6,880 long tons,² an overall length of 470

¹ Taggart (ed.), "Ship Design and Construction" (1980), cites U.S. Coast Guard booklet CG-993 (Forms for Stability Test Reports) as defining light ship displacement as the weight of the ship, complete in every respect with water in boilers at steaming level and liquids in machinery and piping, but with all tanks and bunkers empty and no passengers, crew, cargo, stores, or baggage. This is not the weight used to calculate the sampling requirements.

² One long ton equals 2,240 pounds.

feet, and a beam of 73 feet. When fully loaded, it displaces 19,405 long tons at a draft of 30.6 feet. The ship is powered by two, oil-fired, superheating Babcock & Wilcox boilers feeding steam to a single two-stage General Electric steam turbine. The turbines provide up to 13,750 horsepower to a single shaft and a nonferrous propeller through a double reduction gear, driving the ship at a maximum speed of approximately 18.5 knots. The hull is assembled from welded and riveted steel and incorporates six cargo holds, each served by a hatch and cargo-lifting gear.³

- SHIRLEY LYKES was built in 1962 for MARAD by the Bethlehem Steel Corporation's Shipbuilding Division, Sparrows Point, Maryland. After serving for 10 years as a two-deck, general cargo ship, in 1972 it was lengthened approximately 95 feet by Todd Shipyards Corporation, Galveston Division, Galveston, Texas to incorporate a container hold. The ship has a light ship displacement of 8,606 long tons, an overall length of 592 feet, and a beam of 69 feet. When fully loaded, it has a displacement of 22,892 long tons at a draft of 30.1 feet. The ship is powered by two oil-fired, superheating Foster-Wheeler boilers feeding steam to a single two-stage General Electric steam turbine. The turbines provide up to 11,000 horsepower to a single shaft and a built-up stainless steel propeller through a double reduction gear, driving the ship at a maximum speed of approximately 18 knots. The hull is made of welded and riveted steel and incorporates six cargo holds. Five are served by hatches and cargo-lifting gear.⁴
- WAYNE VICTORY was built in 1945 by the California Shipbuilding Corporation, Los Angeles, California. This is a three-deck, general cargo ship having a light ship displacement of 4481 long tons, an overall length of 470 feet, and a beam of 73 feet. When fully loaded, it has a displacement of 15,200 long tons at a draft of 29.9 feet. The ship is powered by two oil-fired, saturated steam Henry Vogt boilers feeding steam to a single two-stage Allis Chalmers steam turbine. The turbines provide up to 6,600 horsepower to a single shaft through a double reduction gear, driving the ship at a maximum speed of approximately 15 knots. The hull is made of welded and riveted steel and incorporates five cargo holds, each served by a hatch and cargo-lifting gear.⁵

³ American Bureau of Shipping, *RECORD 1990*, p. 489.

⁴ Ibid., p. 1288.

⁵ Ibid., p. 1490 and Sheet 4 of MARAD drawing VC2-S-AP2.

2.0 SAMPLING

Sampling was conducted between October 12, 1995 and November 7, 1995 aboard the three ships at their moorings at the James River Reserve Fleet, Fort Eustis, Virginia. The sampling was performed in accordance with the plan presented in Reference 1. Sampling for polychlorinated biphenyls (PCBs) followed specific, detailed guidelines provided by the U.S. Environmental Protection Agency (EPA) (Reference 8).

2.1 PCB SAMPLING DESIGN

Both the Sampling Plan and the EPA Guidance Document call for sampling materials for PCBs in three classes of materials:

- Electric cables. The Navy has found PCBs in many different kinds of electric
 cables. Cables contain an abundance of valuable copper and are considered an
 asset by ship recyclers. Therefore, to preclude inappropriate handling and
 dispositioning of electric cables during ship breaking/recycling, the EPA guidance
 requires special emphasis on cables.
- Ventilation system gaskets. Certain wax- or grease-impregnated felt gaskets are often used in shipboard ventilation systems. The felt is a commercial material used in other industrial applications. In its Guidance Document (Reference 8), EPA presumes felt gaskets will be found in commercial ship ventilation systems and therefore requires particular attention be given to them.⁶
- Other PCB materials. The Navy has found PCBs in a wide variety of nonmetallic materials used aboard U.S. warships and submarines. In its guidance document, EPA divides these materials into eight categories and requires samples of each category.

In addition, the EPA Guidance document specifies the total number and distribution of the samples that are to be taken. The number and distribution are defined as "quota" and "strata," respectively, as follows:

- Sample quota. The total number of samples is to equal the square root of the gross weight (GW) of the ship at the time it is offered for recycling.
- Deck quota. At least three samples must be taken from each deck of the ship, including decks below the weather deck (where the ship's engineers are located and the cargo is stored) as well as above the weather deck (where navigation and living

⁶ A letter from the Assistant Secretary of the Navy (Installations and Environment) to the EPA dated 17 April 1995 provides detailed comments on the new PCB rules proposed by EPA in December 1994. The letter details Navy experience with PCBs in U.S. warships and submarines.

quarters are located). A simplified drawing showing the arrangement of the decks and holds of a typical cargo ship is presented as Figure 1.

- Compartment selection. Each compartment and passageway in the ship being sampled is assigned a number, and the compartments and passageways from which samples are recovered are selected by random from among all the compartments and passages, subject to meeting the deck quota.
- Sample stratum 1, electric cables. The number of cable samples must be 0.4 times the total number of samples, and at least 75% of the cable samples are to be recovered from engineering and electrical and electronics equipment spaces.
- Sample stratum 2, ventilation system gaskets. The number of ventilation gasket samples must be 0.4 times the total number of samples, and at least 50% are to be recovered from engineering spaces and areas where fuel, explosives, and munitions are stored and handled.
- Sample stratum 3, other PCB materials. The number of other materials sampled for PCBs must be 0.2 times the total number of samples. This stratum is further divided into eight categories of materials. At least one sample from each of the eight categories is to be selected from each ship.

2.1.1 EPA Guidance Document Requirements

The strata and quota criteria were developed by EPA from data provided by the Navy on the PCB materials contained in warships. There are significant differences between warships and commercial ships. Commercial cargo ships have much smaller engines and fewer crew quarters, simpler internal ventilation and electronics systems, no weapons systems, large interior cargo holds which are devoid of systems and machinery, and displacements which are often significantly greater than those of warships. To illustrate, Table 1 compares the features of SHIRLEY LYKES with those of a modern Navy cruiser, the USS TICONDEROGA, CG 47. When applied to a commercial ship, the EPA guidance (Reference 8) leads to a large number of samples with comparatively fewer opportunities to meet all of the quota and strata requirements.

Despite this problem, sampling was conducted, to the maximum extent practical, in conformance with the EPA guidance. The following sections discuss the problems encountered.

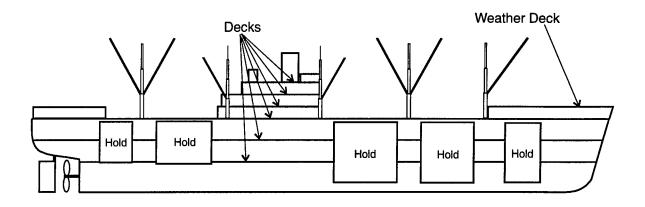


Figure 1. Typical Cargo Ship

Table 1. Features of SHIRLEY LYKES and USS TICONDEROGA

CHARACTERISTIC	SHIRLEY LYKES	USS TICONDEROGA ⁷
Length	598 feet	568 feet
Engine Power	11,000 shaft horsepower	86,000 shaft horsepower
Number of Weapons Systems	0	25
Crew Size	25	362
Fuel and Cargo Capacity	14,286 tons	2,270 tons
Light Ship Weight	8,606 tons	7,260 tons
Full Load Displacement	22,892 tons	9,530 tons
Electric cable weight	<1% of LSW	~6% of LSW ⁸
Ventilation gaskets	up to 2009	up to 4000 ¹⁰

2.1.1.1 <u>Total Sample Quota and Strata Quota</u>

Table 2 shows the GW of each of the three ships; the total sample requirements (the square root of GW); the number of cable, ventilation gaskets, and other samples required both by the EPA (Reference 8) and by the Sampling Plan (Reference 1); and the number of samples that were recovered and analyzed.

Note that the GW used for selecting the number of samples is not the same as light ship weight, discussed above. The EPA requires the weight of the ship as delivered for recycling to be used in the calculation, and this can differ from LSW because of differences in fluid loadings, removal of equipment and other factors.

⁷ J. L. Couhat, ed., *Combat Fleets of the World 1986/87*, Naval Institute Press, Annapolis, Md., 1986, pp. 629-631.

⁸ B. Jackson, Naval Sea Systems Command, January 1996.

⁹ Based on a walkthrough inspection of SHIRLEY LYKES by MSCL representatives. Actual gasket counts have not yet been made.

¹⁰ T. Pape, Westinghouse Machinery Technology Corporation, January 1996.

Table 2. Gross Weight, Strata Quota, and Number of Samples Collected

	E	EXPORT CHALLENGER				SHIRLEY LYKES			WAYNE VICTORY			
	GW	EPA Quota	Plan Quota	No. Collected	GW	EPA Quota	Plan Quota	No. Collected	GW	EPA Quota	Plan Quota	No. Collected
Totals	7700	88	88	93	5700	75	75	79	3400	58	58	60
Cables		36	36	35		31	31	31		23	23	24
Vent. Gaskets		36	36	30		31	31	27		, 23	23	23
Other		16	16	28		13	13	21		12	12	13

Table 2 shows that, except for cables and ventilation system gaskets in EXPORT CHALLENGER and ventilation system gaskets in SHIRLEY LYKES, the number of samples recovered and analyzed equals or exceeds the number recommended by EPA and required by the Sampling Plan (Reference 1). The number of cable and gasket samples taken was reduced in favor of samples of other PCB materials for four reasons:

- As sampling progressed, many samples of identical cables and ventilation gasket materials were being recovered. A full set of samples in accordance with the plan did not appear to be needed to identify PCB problems.
- Because the ventilation systems in the ships were small relative to military ships, it was judged that the criteria called for excessive sampling of gaskets.
- The criteria did not allow for adequate sampling in the "Other" category. With only 12 to 16 samples required for eight different categories of other materials, a good representation was not being recovered. Increased sampling in the "Other" category was considered appropriate, but the sampling and analysis budget would not accommodate a large increase. Some cable and gasket samples had to be eliminated to allow for the switch.
- The plan did not include samples for oil and grease, common PCB-contaminated materials in military ships.

Thus, the number of samples was adjusted to favor the Other category, and samples for oil and grease were added. Overall, the total number of samples exceeds by 11 the number specified in the Sampling Plan.

2.1.1.2 Deck Quota

The EPA Guidance Document (Reference 8) requires at least three samples from each deck. Tables 3, 4, and 5 show the number of samples taken from each deck of the three ships. Because of ship construction and deck nomenclature differences, a separate table is provided for each ship.

Table 3. Samples Taken From Each EXPORT CHALLENGER Deck

EXPORT CHALLENGER*					
Deck	No. of Samples Taken				
Navigation Bridge & Boat Deck Top House Top	4				
Aft House Top	2				
Lower Bridge and Boat	3				
Forward House Cabin	4				
Aft House Bridge	11				
Poop	14				
Main	31				
Second	11				
Third	9				
Orlop and Tank Top	2				

^{*}Two samples not identified as to deck

Table 4. Samples Taken From Each SHIRLEY LYKES Deck

SHIRLEY LYKES*					
Deck	No. of Samples Taken				
Navigation Bridge	5				
Boat Deck & Cabin	4				
Upper, Foc'sle & Winch Platforms	14				
Main	29				
Upper Tween	8				
Machinery Space	15				

^{*}Four samples not identified as to deck

Table 5. Samples Taken From Each WAYNE VICTORY Deck

WAYNE VICTORY*				
Deck	No. of Samples Taken			
Top of Wheelhouse	2			
Bridge	4			
Cabin	6			
Boat	6			
Main	15			
Second	8			
First Platform	2			
Machinery Space	15			

^{*}Two samples not identified as to deck

The deck quota requirement was met in nearly all cases. In those where it was not, this was due to the absence of the materials specified in the EPA Guidance Document (Reference 8). Most of the samples were taken in areas of the ships where there are concentrations of machinery, such as the main deck, machinery spaces, and decks where cargo handling machinery is mounted. These decks had a larger number of target materials than others. The cargo holds did not contain any of the materials specified in the EPA guidance.

2.1.1.3 Cable Sample Criterion

The EPA guidance (Reference 8) requires that 75% of all cable samples be recovered from "electric cable in engine compartments, auxiliary machinery compartments, areas having radio transmission and receiving equipment, x-ray equipment, radar equipment and any other high-voltage electrical equipment." The ship's spaces meeting this requirement in EXPORT CHALLENGER are the Navigation Bridge, the Lower Bridge, the Aft House Bridge and the Main, Second and Third Decks. In SHIRLEY LYKES, the compliant spaces are the Navigation Bridge, the Main Deck and the Machinery Space; and in WAYNE VICTORY, the First Platform, Machinery Space, the Bridge, and the Main and Second Decks.

Table 6 shows that only in WAYNE VICTORY does the actual sampling conform to the guidance criteria. The electrical and electronic systems contained in commercial ships are very simple compared to the Navy warships around which the EPA guidance was patterned and do not necessarily afford adequate sampling throughout, with minimal crew and passenger accommodations. Cable sampling in this ship met the criteria only because there are few spaces other than the types cited.

Most commercial cargo ships of the type sampled in this study have a single or only a few "engineering spaces," unlike that of typical Navy vessels. If sampling in these ships had conformed to the EPA guidance that 75% of all cables samples must be recovered from these defined spaces, a high number of samples would have been taken from a small percentage of the ship's cable "population." The remaining 25% of the samples would have to spread over the remaining non-engineering spaces of the ship, likely resulting in an underestimate/under sampling of cables in the berthing, crew and cargo areas.

Table 6. Cable Samples

	No. of Cable Samples	No. of Cable Samples Taken From Engineering & Electrical Spaces	%
EXPORT CHALLENGER	35	25	71
SHIRLEY LYKES	31	19	61
WAYNE VICTORY	24	20	83

2.1.1.4. <u>Ventilation System Gasket Criterion</u>

The EPA guidance (Reference 8) requires that 50% of all ventilation gaskets be recovered from "air handling systems gaskets [in] engine compartments, auxiliary machinery compartments, and in areas where . . . fuel, explosives and munitions were stored and handled." Table 7 compares this guidance with the actual sampling performed. Although there are no munitions or explosive handling areas on these ships, the sampling nonetheless met the EPA criteria.

Table 7. Ventilation Gasket Samples

	No. of Vent Gasket Samples	No. of Vent Gasket Samples Taken from Engineering, Fuel, and Munitions Spaces	%
EXPORT CHALLENGER	30	21	70
SHIRLEY LYKES	27	14	52
WAYNE VICTORY	23	14	61

2.1.1.5 Other PCB Materials Criterion

The EPA guidance divides the Other PCB Materials stratum into eight categories. To facilitate data sorting, MSCL assigned a number to each EPA category, as shown in Table 8.

Samples in each of these categories were recovered from the three ships except for categories 4 and 6 from WAYNE VICTORY, and category 8 from EXPORT CHALLENGER and WAYNE VICTORY, where no samples of those materials were found.

Table 8. Categories for Other PCB Materials

CATEGORY	MATERIAL
3	Rubber gaskets, other than ventilation system gaskets
4	Felt gaskets, other than ventilation system gaskets
5	Fiberglass, felt, foam, or cork thermal insulation
6	Sound-deadening felt
7	Grout, caulk, rubber isolation mounts, foundation mounts and adhesives (MSCL added valve packing and unused paint to this category)
8	Tapes
9	Pipe hanger liners
10	Rubber and plastic parts of all sizes and shapes, other than those listed above
11	Oil and grease. ¹¹ The U.S. Navy finds PCBs in shipboard lubricants in about 3% of the samples recovered. ¹²

2.2 NON-PCB SAMPLES

The sampling requirements for the other potential contaminants were developed from engineering judgment as to the types of contaminants that might be encountered in ships built before the mid-1960s. Many materials that are now regarded as hazardous were then in common use. Samples were taken of thermal insulation, floor and ceiling tiles, valve packing, gaskets, pipe hanger liners, caulks, mastics and electric cables for analysis for asbestos; metal parts for analysis for cadmium plating; coolants for ethylene glycol; refrigerants for Freon; fluorescent tubes for mercury; and paint for lead and organo-tin and coal tar residues. While the ships may contain many other potential contaminants (e.g., bilge water, rodent and bird feces) that are regulated by current laws, MSCL concluded that the sampling described above

¹¹ The EPA sampling requirements (Reference 8) do not specify requirements for sampling liquid PCBs; therefore, the Sampling Plan (Reference 1) does not require liquids to be sampled. However, the EPA guidance discusses more than sampling requirements for solid PCB materials, specifying as well the removal and proper dispositioning of all liquid PCB materials in vessels undergoing recycling. Because PCBs have been found in greases and lubricants in the past, MSCL considered it appropriate to obtain a few samples to determine whether greases or lubricants are likely to be a problem. Therefore samples were taken from the steering engines and a windlass on each ship. These samples are identified as category 11. The sampling for liquids reported herein is not statistically based and should not be used to draw firm conclusions about whether or not liquid PCBs are present. The results, which show no PCBs in the samples taken, indicate only that liquid PCBs may not be a significant problem in the ships that were sampled.

¹² Naval Sea Systems Command document, "INACTSHIP PCB Survey Results, Number of Samples by Range/Category, 11/30/95."

would be sufficient to indicate the presence or absence of significant potential environmental, safety and health issues.

3.0 ANALYSIS

3.1 PROCEDURES

Analysis of samples was conducted in accordance with the methods described in the Sampling Plan (Reference 1). Portions of each sample were weighed and tested and the results expressed in parts per million (ppm) by weight for PCBs, cadmium, lead, mercury and tin; in percent by weight for asbestos and ethylene glycol; and by refrigerant type for refrigerants. For cable PCB analysis, a short section of the cable sample was stripped of all metal components, including the lead covering where encountered. The remaining nonmetal components were then weighed and tested, with the results reported in parts per million PCBs. Toxicity characteristic leachate procedure (TCLP) tests were performed on cable samples prepared in the same manner as for PCB analysis, but with PCBs extracted using EPA Test Method 131, "Test Methods for Evaluating Solid Waste, Physical/Chemical Methods," found in EPA publication SW-846.

The analysis work was done by two laboratories. Environmental Testing Services Incorporated (ETSI) in Norfolk, Virginia, analyzed all ventilation gaskets, all other-PCB-material samples, and the initial cable screening analyses discussed in Section 4.1.2.2. Except for two cable samples from SHIRLEY LYKES, all final cable analyses were performed by ETS Analytical Services Incorporated of Roanoke, Virginia.

Quality assurance at ETSI (Norfolk) was performed in accordance with the quality assurance portion of the Sampling Plan (Reference 1). The laboratory plan calls for chain-of-custody records and periodic surrogate spikes, matrix spikes, blanks, and analysis precision determinations. The chain-of-custody records were provided with the final analysis results and were reviewed by MSCL and found to match the results. ETSI retains the records of the spikes, blanks, and precision determinations in-house; the laboratory manager certifies conformance with the quality assurance plan by signing each analysis report.

ETS Analytical Services' (Roanoke) quality assurance is not part of the Sampling Plan, because that laboratory was brought into the program toward the end of the analysis work in order to speed completion of the analysis of electrical cables. However, this is an EPA Contract Laboratory, and thus maintains high standards of quality. To verify quality, ETS Analytical Services has reported the results of surrogate analyses. These results, provided to MARAD under separate cover, show conformance to EPA criteria for surrogate recovery, i.e., the analysis results for surrogate chemicals that were added to the samples were within the required analysis range (50% to 150% of expected results for a least one surrogate), indicating adequate recovery of the PCBs and accurate PCB analyses.

One quality assurance criterion, completion of solid PCB analyses within 40 days of sampling, was not met. This was due to significant analysis difficulties which are discussed below. Inasmuch as the samples represented parts removed from the uncontrolled environment of the ships and placed in controlled storage at a laboratory, this is not judged to be a significant shortcoming.

3.2 DIFFICULTIES

The most common method for analyzing for PCBs in solid materials is first to extract the PCBs using EPA method 3550A, "Polychlorinated Biphenyls and Pesticides, Modified Extraction Procedure, Matrix: Soils," followed by analysis using EPA method 8080, "Standard Operating Procedure for Data Analysis of PCBs and Pesticides by GC/ECD." The extraction procedure takes a few minutes and is efficient at attacking and destroying most plastics and rubbers, extracting the PCBs, and producing a liquid extractant that can easily be processed for analysis by the GC/ECD process (Gas Chromatography with Electron Capture Detector).

In its guidance document (Reference 8), EPA specified use of the Soxhlet extraction apparatus with toluene as a solvent. This requirement created several difficulties, as follows:

- Toluene is a common environmental contaminant that is often the target of analysis. The presence of large amounts of toluene as a solvent in the laboratory risks cross-contamination with other samples. Special precautions were needed to avoid this problem.
- Toluene is not the normal solvent for the extraction of PCBs. Tests were necessary to ensure that the extracted PCBs could successfully be transferred to the proper solvent (n-hexane) required for final analysis. During analysis of epoxy glue and one sample of foam rubber (ETSI sample numbers 7517, 7518 and 7228, respectively) the toluene extract solidified, making PCB analysis impossible.
- The Soxhlet extraction procedure is slow. It takes one or two days for a single apparatus to complete an extraction and be made ready for the next extraction.
- The Soxhlet extraction apparatus requires a larger sample than the ultrasonic method; therefore, more sample preparation is required.

Very high PCB levels were encountered, (e.g., felt; cable), with some samples exceeding the calibration range of the gas chromatographs. When this occurred, samples had to be repeatedly diluted to reduce concentrations of PCBs to within the range of the instruments. To flush out residues remaining in the instruments after a high-level sample and avoid contamination of subsequent analyses, two blanks (PCB-free) were run between each sample, adding to the analysis time.

It is not clear that the extraction procedure effectively recovered all of the PCBs. The toluene solvent did not dissolve the plastic or rubber parts during the extraction, as is usually the case when methylene chloride is used. Therefore residual PCBs may have remained inside the materials, causing analysis results to be biased low.

4.0 RESULTS

Detailed results of the analyses performed by both laboratories have been forwarded to MARAD separately. A summary of the results is provided in the following sections. The very high PCB levels found in some of the samples were difficult to determine with accuracy. In some instances, the laboratory results were in excess of the calibration standards for the procedure. Values for these samples are reported as being equal to the highest calibration standard (thousands of parts per million), as their actual value lies outside the accepted calibration curve. Due to the potential for error, an extrapolated value is not acceptable. In some instances, the laboratory reported >xxx where xxx is a numerical value of thousands of parts per million for PCBs. In these instances, the value is reported in the tables as xxx. Also, the PCB values in the tables are reported as total PCBs (the sum of all detected Aroclors). All total PCB values in the tables at or above 50 ppm are highlighted in gray.

Consistent with the Sampling Plan, the data from the sampling and analysis program are reported in four groups: Electric cables, ventilation system gaskets, other PCB materials, and non-PCB samples.

4.1 ELECTRIC CABLES

4.1.1 Cable Construction

Based on its appearance, most of the cable in EXPORT CHALLENGER and SHIRLEY LYKES appears to conform to Institute of Electric and Electronic Engineers (IEEE) Specification 45, Type A/Z.¹³ This is a standard commercial specification for shipboard cables used at the time of construction of these ships. Some of the cable in WAYNE VICTORY appears similar to that in EXPORT CHALLENGER and SHIRLEY LYKES, but much of it was built to an earlier, unknown specification calling for an outer lead cover in addition to armor braid and plastic or rubber insulation. Typical cable construction used in EXPORT CHALLENGER and SHIRLEY LYKES is illustrated below as Figure 2.

¹³ B. Jackson, Naval Sea Systems Command, January 1996.

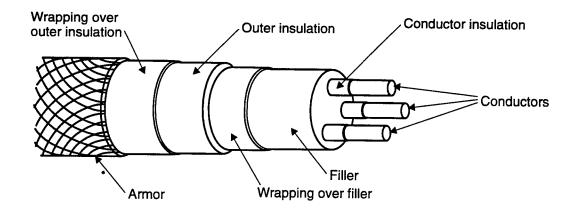


Figure 2. Typical Electric Cable

4.1.1.1 Metal Parts

Most shipboard cables have two distinctly different metal parts, the conductors and the armor. The electric conductors in all cable samples from the three ships were visually identified as copper. Braided metal armor on the outside protects the outermost plastic or rubber electrical insulation cover from damage during installation and subsequent maintenance. In EXPORT CHALLENGER and SHIRLEY LYKES, the armor often appeared to be bronze. Some armor in these ships was a gray metal which could have been steel or aluminum. In WAYNE VICTORY, steel armor was used, as evidenced by the severe rusting observed. Copper conductors and armor metals comprise 50 to 75% of the total weight of shipboard cables, and nonmetallic materials make up the rest.¹⁴

The copper in electric cables is one of the valuable items in a recycled vessel. While the amount of cable in a ship varies widely, a typical 5000-ton freighter will contain up to 25 tons. Of that, up to 19 tons could be copper having a current market value of \$31,000 (\$1,600/ton).¹⁵

¹⁴ Personal communication from K. Ellis, Seawitch Salvage, to J. Burritt and S. Shaw, MSCL Inc., July 19, 1995.

¹⁵ The *Iron Age Scrap Price Bulletin* of January 15, 1996 cites the dealer's price for copper wire scrap as ranging from \$0.70 to \$0.81 per pound. At \$0.81 per pound, 30 tons of Number 1 wire scrap would have a value of \$48,600.

4.1.1.2 Nonmetal Parts

The outermost nonmetal part of a typical cable is a thin plastic wrapping overlaying a thick plastic cover that provides the outermost electrical insulation for the assembly. Immediately inside this cover is often a thin plastic wrapping surrounding a fibrous, putty, or plastic material that fills the spaces between the conductors. Imbedded in the filler are from 1 to 30 conductors, each coated by one to three layers of plastic, fabric, or a mixture of both, to electrically insulate each from its neighbors. Sometimes, the coatings on the conductors are uniquely colored to aid in the proper connection of the wires.

There are from 1 to 93 individual nonmetallic parts in each of the cable samples taken from the three ships. See Tables 9, 10, and 11 and Appendix A for details. The average number of parts varied from 9 in EXPORT CHALLENGER and WAYNE VICTORY to 15 in SHIRLEY LYKES.

4.1.2 Cable Analysis

4.1.2.1 Change in EPA Guidance Requirements

EPA's guidance for sampling ships for PCBs (Reference 8) specifies the number of cable samples to be taken and requires that each individual nonmetallic part of each cable sample be analyzed for PCBs because each is regulated separately as a PCB item. ¹⁶ The PCB analysis requirement, coupled with the large number of nonmetallic parts in typical shipboard cables, presents vessel recyclers with a costing dilemma. The very high cost of analysis of the cables may exceed their value on the scrap market.

This problem was addressed in a letter to EPA (Reference 9) in which it was noted that individual parts of cables are not reused in the United States. Instead, cables are shredded for recovery of the copper, and the nonmetallic residue from the shredding is then disposed of separately. Because this project deals with domestic and not foreign ship recycling, where uses of recycled cables may differ, the letter recommended that EPA permit a single PCB analysis of a cross-section of the nonmetal materials in each cable sample as being most representative of the typical cable recycling process used in this country. This change would also significantly reduce the analysis cost of the project.¹⁷ The letter also recommended that

¹⁶ See References 3 and 4.

¹⁷ The so-called EPA "fluff rule" permits automobile and white goods recyclers to evaluate nonmetallic "fluff" from shredding operations based on the average PCB concentration of the fluff rather than on the individual PCB concentration of any constituent in the fluff.

TCLP tests¹⁸ be run on any cable sample found to contain concentrations of PCBs at or above 50 ppm. TCLP data would provide information to EPA for determining appropriate restrictions on land burial of PCB-contaminated cables. In its reply (Reference 10), EPA concurred with these recommendations. This change was subsequently agreed to by MARAD; therefore, this report presents the average PCB concentration in the nonmetallic parts of the cable samples and the TCLP results for any cable found to contain levels of PCBs at or above 50 ppm.

4.1.2.2 <u>Selecting Cables for Individual Analysis</u>

As noted above, the EPA guidance (Reference 8) specifies a unique cable analysis procedure. The procedure is cumbersome, slow and expensive. In addition, the cost for TCLP analyses is significant.¹⁹ To reduce the total number of cable analyses, three sorting schemes were employed.

- Analysis by groups. Electric cables were not expected to contain high concentrations of PCBs. 20 Therefore, cable samples were to be sorted by ship, assembled in groups of 10 or fewer, and analyzed to a sensitivity of 5 ppm PCBs, or 1/10 of the EPA standard of 50 ppm. If the group was found to contain PCBs at less than 5 ppm, no single cable could possibly contain PCBs above 50 ppm and no further analysis of cables in the group would be needed. In practice, the analysis laboratory used a sensitivity of 4 ppm and found that only the 24 WAYNE VICTORY cable samples, analyzed in two groups of 10 and one group of 4, passed the test (i.e., no WAYNE VICTORY cable in any group could have contained levels of PCBs above 40 ppm). For EXPORT CHALLENGER and SHIRLEY LYKES, high PCB values were found in all the groups, indicating that at least one, and probably many, of the cables in each group contained PCBs at or above the EPA standard of 50 ppm.
- Elimination of duplicates. Each cable sample was visually examined. Many cables were found to look the same as others. This is not surprising. One type of cable will be used for many different services throughout a ship, and one single cable may service several compartments. The random sampling plan could therefore select the same cable or the same type of cable more than once. To eliminate analysis of duplicate samples, one sample from each group of duplicates was

¹⁸ See 40 CFR 261 and EPA Test Method 1311 in "Test Methods for Evaluating Solid Waste, Physical/Chemical Methods," EPA Publication SW-846, for a detailed description of the TCLP test and its place in regulation of hazardous wastes.

¹⁹ Additional cable analyses were performed at a cost of \$85 for PCBs and \$160 for TCLP. The cost for additional cable analyses was less than the cost for each first analysis (\$105) because much of the sample preparation work was already completed.

²⁰ The Navy has found that about 20 percent of the cables tested contain PCBs above 50 ppm.

chosen for further analysis. To test whether or not visually identical cables in fact had the same PCB levels, tests of some visual duplicates were performed. Results are shown in Table 12.

• Elimination of dry cables. No grease or wax residues could be seen or felt in the internal components of many of the WAYNE VICTORY cables, unlike the samples from the other two ships, and all cables tested contained levels of PCBs less than 50 ppm. During extraction of the two groups of ten, the solvent did not attack the dry parts, instead extracting only the waxy matter. Therefore, any cable which was free of a waxy or greasy material was eliminated from further analysis. This reduced from 50 to 35 the number of individual cables analyzed for PCBs.

The overall process for selecting cables for further analysis is illustrated in Figure 3.

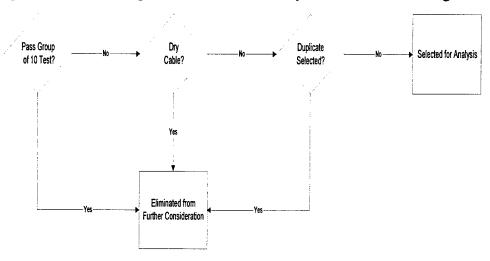


Figure 3. Process for the Selection of Cables for Further Analysis

4.1.3 Cable Analysis Results

Appendix A provides a detailed physical description of each of the cable samples. Descriptions for a few of the cables are not provided because the cables were undergoing analysis at the time the inspections were made and could not be made available.

A summary of the results of the chemical analyses and physical inspections of the cables are shown in Tables 9, 10, and 11. The data in the tables are organized in order of the ETSI number, and concentrations of PCBs at or above 50 ppm are highlighted in gray. Table headings are explained in Figure 4. Cable samples that were not individually analyzed are recorded as either "dry," indicating the sample exhibited no greasy or waxy impregnant, or as a four-digit number in brackets. This four-digit number is the ETSI sample number of the sample's visual twin.

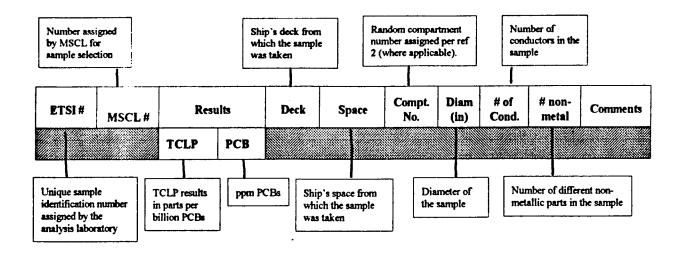


Figure 4. Key for Column Headings, Tables 9-11 and 13-18.

Table 9 summarizes results for EXPORT CHALLENGER. Ten of the 35 cable samples (28%) contained PCBs at or above 50 ppm. All TCLP analyses were less than 5 parts per billion.

Table 10 summarizes the results for SHIRLEY LYKES. Twenty-two of 31 cable samples (71%) contained PCBs at or above 50 ppm. All TCLP analyses were less than 5 parts per billion.

Table 11 summarizes the results for WAYNE VICTORY. No PCBs were found. Only in WAYNE VICTORY were lead-covered cables found (13 of 24 samples.) The internal nonmetallic components of all of the lead-covered cables were dry to the touch, with no evidence of a waxy or oily impregnating material. Some of the non-lead-covered cables evidenced a waxy or oily impregnating substance in the internal materials that was physically similar to the impregnant in the cables from the other two ships, but the impregnant did not contain PCBs.

4.1.4 Evaluation of Visually Identical Cable Groups

To test the assumption used to sort cables for analyses based on their visual appearance, individual PCB analyses were conducted on three cables in a set of four identical cables, and two cables in a second set of four identical cables. All the cables were from SHIRLEY LYKES. The results are shown in Table 12.

Comments		depth sounder cable, aft bulkhead	Radar power supply	Fwd bulkhead	lamp pwr cord	cable behind console	in locker	cable on stbd wing	port cargo boom winch motor	outlet power cable	in overhead	in overhead	in overhead	desk lamp cable	William to the state of the sta	switch in passageway	light switch wire	alarm switch wire	aft bulkhead receptacle wire	aft bulkhead	overhead	light switch cable		light cord on overhead	battery cable	large cable on switchboard	switchboard cable		raceway		fwd bulkhead	motor power	evporator, stbd	behind maneuvering panel	phone bell, fwd bulkhd by throttle		AND THE RESIDENCE OF THE PROPERTY OF THE PROPE		The state of the s
# non- metal		5	2	5	9	20	∞	17	*	7	4	4	10	4	7	7	1	8	5		∞	2	\$	10	2	10	13	6	6	6	10	13	27	∞	13	13	6		
# of Cond.		2	-	2	3	19	2	7	*	2	2	2	3	2	2	2	2	2	-	-	2	2	2	3	_	3	3	3	£,	2	3	3	12	2	3	3			
Diam (in)		1/2	-	1/2	3/8	1/2	1/2	3/4	*	3/8	1/2	1/2	1/2	1/2	3/8	1/2	3/8	3/8	3/8	1/4	1/2	3/8	3/8	1 7/8	1/2	1 7/8	2	8/8	8/8	3/8	11/4	1 1/4	_	3/8	1		nents		
Compt. No.		-	2	4	_	7	∞	3	-	19	=	12	15	<u>&</u>	35?	15	38	35	39?	31	25	29	42	4	12	16	17	-	18		13	2					-metal compo		
Space		Wheel House	chart room	gyro room	Capts SR	radio room	passageway	deck wing	forecastle deck	officer's laundry	bosun SR	chief electr SR	cook/baker SR	F/W & oiler SR	cleaning gear Ikr	paint locker	dairy room	cargo meat room	galley	slop chest	pantry	soiled linen Ikr	dry stores	special cargo rm	MG room	hydraulic pump rm	MG/fan room	bosun stores	paint room	machinery space	engr's workshop	refrigerator room	machinery space	machinery space	machinery space	machinery space	Average number of non-metal components	Sng	wy]
Deck		Nav Bridge	Nav Bridge	Nav Bridge	Lower Bridge	Lower Bridge	Fwd House Cabin	Fwd House Cabin	Fwd House Cabin	Aft House Bridge	Poop	Poop	Poop	Poop	Poop	Second	Main	Main	Main	Main	Main	Main	Main	Main	Main	Main	Main	Second	Main		Second	Third	Third	Third	Third	Tank Top	r inspection	n/a = not analyzed Dry = Sample not analyzed because internals were dry [xxxx] = Sample not analyzed Visually identical in [xxxx]	בכח. עומחמון ותכוווניםו וכי ביה
lts	PCB	Dry	Dry	65	Dry		20	⊽	Dry	15	<1	[6607]	[7078]		[7088]	48	530	[7227]	Dry	Dry	70	26	[7205]	099	Dry	490	1100	[7226]	81	47	Dry	Dry	Dry	[7227]	790	[7249]	available fo	zed e not analyz	C Irot annu y
Results	TCLP	n/a	n/a	\$	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	\$	۵	n/a	n/a	n/a	<\$	<\$	n/a	٧	n/a	۵.	\$	n/a	n/a	۵	n/a	n/a	n/a	n/a	۵	n/a	* Sample not available for inspection	n/a = not analyzed	לוויות [עעע
MSCL#		-	2	3	4	9	6	80	10	17	23	24	25	28	32	53	44	46	39	36	38		42	54	59	62	64	29	99	82	69	74	78	72	76	73		ے ج	4
ETSI#		8902	4902	1707	7072	7074	7077	7078	6202	7088	7094	7095	7097	7099	7104	7198	7200	7201	7202	7203	7204	7205	7206	7212	7215	7220	7222	7224	7226	7227	7230	7243	7245	7247	7249	7251			

Shaded text indicates PCB ≥50 ppm.

Table 9. Summary of Results of EXPORT CHALLENGER Cable Sampling

83		Co-ax port side by door	cator	larm.		lephone		ad			Fr. 168-184 Motor Cable	t Motor		100						· · · · · · · · · · · · · · · · · · ·				Aft. Stbd Topping Winch								and the state of t				
Comments		Co-ax pot	Wind Indicator	Wire to Alarm	In Pantry	Plastic Telephone	-	In Overhead		Light Cable	Fr. 168-18	Boat Davit Motor		Receptacle	Coaxial					Overhead		Lamp Wire		Aff, Stbd											: : :	
# non- metal		2	28	~	~	4	8	«	∞	9	«	•	13	&	2	•	7	01	∞	2	01	\$	93	10	&	28	10	10	93	7	=	8	15			
# of Cond.		_	8	2	2	2	2	2	2	3	2	•	E.	2	-	2	2	3	2	7	3	3	30	3	7	∞	3	3	30	2	4	2				moline
Diam (in)		3/8	3/4	3/8	172	1/4	3/8	3/8	3/8	1/4	1 3/4	*	2//8	1/2	3/8	13/4	1 7/8	1/2	2//8	1/2	1/2	3/8	1 3/8	1/2	1/2	3/4	1/2	1/2	1 3/8	1/2	1/2	3/8	ents			Cable Sa
Compt. No.		_	2	4	7	61	17	12	14	10	23	8A	29	2	4	3		9	7	17	22	27	40	30A	5	5	2	5	S	16	10	10	netal compon			T.YKES (
Space		Wheel House	Chart Room	Passageway	Dining Room	Chief Mate SR	3rd, Mate #2 SR	Jr. Asst Eng SR	3rd. Asst Eng SR	Spare SR	Winch Platform	Weather Deck Port	MG Room	Windlass Room	Radar Room	MG Room	Deck penetration	MG Room	MG Room	Deck Util SR	EDG Room	SR	Hoist Machy Rm.	Weather Deck	Eyaps	By SSTG Stbd.	LL Port (pump)	SS Air Comp	Temp, Recorder	Eng. Stores	Deck spares	Deck spares	Average number of non-metal components	le not analyzed because internals were dry	[x	Summary of Results of SHIRLEY LYKES Cable Sampling
Deck		Nav Bridge	Nav Bridge		Upper/Focsle/Winch		ij		/Winch	7	/Winch	Upper/Focsle/Winch	Main	Main	Main	Main	Upper/Focsle/Winch I	Main	Main	Main	Main	Main	Main	Main		Machinery Space	Machinery Space	Machinery Space S	Machinery Space 7	Upper Tween	Upper Tween	Upper Tween	inspection	y = Sample not analyzed becar	[xxxx] = Sample not analyzed. Visually identical to [xxxx]	Table 10. Summary of
rs.	PCB	Dry	3,900	[7454]	360	Dry	[7454]	[7454]	<1	167	2,400	2,710	1,700	[7174]	Dry	2650	- 99	36	>	[7174]	130	201	[7442]	[7283]		[2168]	394	8.3	869	\ 		320	vailable for	ılyzed. Dr	e not analyz	
Results	TCLP	n/a	<\$	n/a	Δ	n/a	n/a	n/a	n/a	٧.	\$>	\$	<	n/a	n/a	<\$	*≎	\$	n/a	n/a	\$	\$	n/a	n/a		n/a	\$	n/a	\$	n/a	n/a	*>	*Sample not available for inspection	n/a = not analyzed. Dry = Sampl	cxx] = Sample	:
MSCL#		-	2	*	6	21	20	16	18	7	23	73	43	24	28	26	29	30	32	34	36	42	46	75	- 26	57	55	59	58	99	79	- 80	*		(x)	
ETSI#		9912	7168	1169	7174	7176	7178	7179	7182	7185	7188	7190	7193	7265	7267	7268	7270	1271	7275	7281	7283	7291	7293	7295	7431	7433	7436	7440	7442	7451	7453	7454	_			

Shaded text indicates PCB ≥50 ppm.

		Deck	Space		(E)		meta	Comments
TCLP	PCB			-				
n/a	<40	First platform	Machinery		*	*	*	
n/a	<40	Machinery space	switchboard		1 1/4	2	7	
n/a	<40	Machinery space	77 27 27 27 27 27 27 27 27 27 27 27 27 2		3/4	2	7	fwd bulkhead center
32 n/a	<40	Machinery space	switchboard		8//	-	3	stbd back of switchboard
34 n/a	<40	Machinery space	SSTG		1/2	_	3	aft end of stbd SSTG
35 n/a	<40	Machinery space	Distribution box		3/4	3	6	aft bulkhd port dist box
42 n/a	<40	Machinery space	lower level port		3/4	3	6	main circ pump
6 n/a	<40	Bridge	pilot house		2/8	9	15	
n/a	<40	Bridge	chart room		2//8	9	15	port side fwd bulkhead
3 n/a	<40	Bridge	pilot house		2//8	24	51	port side, cable to radar power supply
n/a	<40	Top of Wheel House			8/8	2	7	starboard king post aft end
11 n/a	<40	Cabin	machinery casing	9	8/8	2	7	fwd bulkhead alarm cable
8 n/a	<40	Cabin	cabin center	4	1/4	3	9	fan cable, port side
9 n/a	<40	Cabin	cabin stbd	91	2/8	2	s	armored fan power cord
15 n/a	<40	Boat	cabin port side	4	1 1/8	2	7	overhead
21 n/a	<40	Main	winch platform	4	1 1/16	2	S	stbd side of CL mast aft of house
19 n/a	<40	Boat	winch platform	19	2/8	2	S	anchor windlass control pwr cable
20 n/a	<40	Main	winch platform	43	8/8	2	s	port side of aft house
31 n/a	<40	Second	room aft flat port fwd	35	8/8	2	5	light cable
29 n/a	<40	First Platform	access to holds 4/5		2/8	2	S	port side main deck access to holds
24 n/a	<40	Main	storeroom aft flat	33	3/8	2	5	fwd cabin port of CL, switch cable
26 n/a	<40	Second	CO2 room port fwd	15	8/8	2	7	
25A n/a	<40	Main	locker port inboard	37	2/8	2	7	port inboard sink room, lite cable
31 n/a	<40	Second	machinery space	22	1 1/8	3	6	stbd side raceway
* Samp	Sample not available for inspecti	e for inspection	'Average	Average number of components	ponents		6	

Table 12. Analysis of Duplicate Cables

	ETSI #	ppm PCBs
	7271	36
First Quadruplicate	7283	130
Set	7436	394
,	7295	n/a
	7174	360
Second Quadruplicate	7265	n/a
Set	7281	n/a
	7431	560

The results show that it may not be correct to select one cable from a group of visually identical cables to represent the group. Note that had sample 7271 been selected to represent the first group, all in the group would have been considered to contain levels of PCBs less than 50 ppm, whereas in fact at least two cables in the group contain levels above 50 ppm.

Assuming that the analysis presents the potential for all visually identical samples to show variability in PCB content, the PCB content of cables as shown in Tables 9, 10, and 11 may over or underestimate actual PCB content of a single cable. This study did not investigate the source of PCBs in cables. PCBs may have been present as part of the cable manufacturing process, or may have resulted from cable installation of operational maintenance.

4.2 VENTILATION SYSTEM GASKETS

4.2.1 Gasket Materials

Seven different kinds of ventilation system gasket materials were found in the three ships. Wax-impregnated felt was found exclusively in WAYNE VICTORY, while the other ships had some felt gaskets along with gaskets made of foam rubber, processed cork, cloth-inserted rubber, solid sheet rubber, a single example of wax-impregnated fabric (in EXPORT CHALLENGER), and a single example of a dry fibrous material (in SHIRLEY LYKES). Each sample was visually inspected in an attempt to determine the gasket materials. Some of the gaskets were severely damaged from many years of use, making identification difficult. With few exceptions, however (noted in the tables as simply "gasket"), identification could be made.

EXPORT CHALLENGER has a large number of similar gaskets that are identified in the table as "processed cork." It is not certain that the material is indeed made from cork; however, the material visually resembles cork—ground to fine particles averaging about 1/16

inch in diameter, mixed with a black rubbery substance, and spread between two sheets of cheesecloth to form a gasket.

4.2.2 Gasket Sampling Results

The results of the ventilation gasket sampling are shown in Tables 13, 14, and 15. (Refer back to Figure 4 for an explanation of the table headings.) Results have been organized into groups of similar materials, and each group is arranged in order of the ETSI sample number. Those containing PCBs at or above 50 ppm are highlighted in gray. Note that in all three ships, half or more of the ventilation system gaskets sampled contained concentrations of PCBs at or above 50 ppm.

Six different kinds of materials were found in the ventilation system gaskets of EXPORT CHALLENGER (Table 13), and two of the material types contained high levels of PCBs. The single felt sample from EXPORT CHALLENGER contained no PCBs.

Three different gasket materials were found in SHIRLEY LYKES (Table 14), and two contained high levels of PCBs.

Felt was the only type of ventilation gasket material found in WAYNE VICTORY (Table 15), and all but one sample showed high levels of PCBs.

4.3 OTHER PCB MATERIALS

4.3.1 Material Categories

Nine different material categories were sampled, as explained in Section 2.1.1.5, and the results are summarized in Tables 16, 17, and 18. Results showing concentrations of PCBs at or above 50 ppm are highlighted in gray. At least three categories of other PCB materials were found in the ships. All three ships had high PCB levels in door and hatch gaskets and machinery gaskets (category 3) and grout, caulk, and rubber isolation mounts (category 7). WAYNE VICTORY and EXPORT CHALLENGER also had high PCB levels in thermal insulation (category 5).

The results for EXPORT CHALLENGER are shown in Table 16. Concentrations of PCBs at or above 50 ppm were found in four of the eight categories sampled. While category 10 (miscellaneous materials) showed no high PCB levels, the processed cork machinery closure gaskets included in this category were visually identical to the processed cork found in ventilation gaskets, nine of which showed high PCB levels.

Results for SHIRLEY LYKES are shown in Table 17. Concentrations of PCBs at or above 50 ppm were found in three of the nine categories that were sampled in this ship. Of particular interest is the high PCB value found in silver duct tape (ETSI # 7292). The tape was fresh and flexible. It appeared to be no more than 1 or 2 years old.

Comments	head, in overhead	overhead vent	overhead vent	center of compartment	fwd port corner	overhead vent	port	overhead vent	crumbled, black. Stbd side	The same of the sa	overhead vent	vent gasket aft of maneuvering panel	overhead vent	overhead vent	overhead vent	overhead vent	overhead vent	overhead vent	overhead vent	overhead vent	overhead vent	aft bulkhead overhead	overhead vent	overhead vent	overhead vent	ducting	aft bulkhead	overhead vent	stbd by boiler	vent duct
Type *	cloth inserted rubber	felt, 1/8", gray	foam rubber	foam rubber, 1/8"	foam rubber, 1/8"	gasket	processed cork	processed cork	processed cork	processed cork	processed cork	processed cork	processed cork	processed cork	processed cork	processed cork	processed cork	processed cork	processed cork	processed cork	processed cork	sheet rubber	sheet rubber	wax impregnated fabric						
Compt. No.	15	33	7	12	9	17		35	10		26		5	17	25	27	20	21		43	12	4	15	7		9	6	12		7
Space	cook/baker SR	able seaman	fan room	MG room	MG/fan room	MG/fan room	machinery space	passageway	reefer room	gyro room	passageway	machinery space	2nd Ofer SR	1st Asst Eng SR	Jr Eng SR	Ch Steward SR	wiper SR	messman SR	Able Seaman/quartermaster	arbage room	chief elect SR	special cargo rm	3rd Asst Eng SR	emerg gen room	messman SR	MG/fan room	reefer/dry cargo rm	2nd Asst Eng SR	machinery space	MG room
Deck	Poop	Poop	Aft house top		Main	Main	Second	Main	Second	dge	Aft House Bridge	Third	Fwd House Cabin 2	Aft House Bridge	Aft House Bridge	Aft House Bridge	Poop	Poop	Poop	Main	Poop	Main	Aft House Bridge 3	Aft House Top	Poop	Main	Third	Aft House Bridge	Second	Main
Results	641	763	133	206	<42	<42	<45		<50		<50	. <50	141	88	254	365	202	160	115	109	223	<50	28	<47	<38	<29		33		<42
MSCL#	26	33	88	27	09	65	80	87	70	84	20	73	7	15	19	21	29	31	35	43	27	55	11	22	98	56	71	12	81	68
ETSI#	8602	7107	7209	7216	7218	7223	7242	6612	7234	7070	7091	7251?	1075	9802		7092	7100	7102	7109	7112	9602	7210	7082	7093	7105	7211	7236	7080	7233	7214

*Based upon visual inspection Shaded text indicates PCB≥50 ppm.

Table 13. EXPORT CHALLENGER Ventilation System Gaskets Sampling Results

Comments	Overhead			Air Handler								Port Side	about 8" diam.		Aft Deckhouse Stbd		fr 144-151 stbd	lightweight, thin, pale grey or light brown										
Material	felt, 1/16", dark brown	felt, 1/8", dark brown	felt, 1/8", dark brown	felt, 1/8"	felt, 1/8", dark brown	felt, dark brown	felt, 1/16", dark brown	felt, 1/8", dark brown	felt, 1/4", black	felt, 1/8", black	felt, 1/8", dark brown	felt, 1/2", dark brown	unidentifiable gasket	fibrous material	foam rubber	npling Results												
Compt. No.	3	9	29	3	Ş	5	S	12	01	13	18	5		9	30A	30	24	5	15	10	. 12	14	20	23	26	13	=	Gaskets Sar
Space	radio cabin	fan room	MG room	МG гоот	LL aft, stbd	by switchboard	boiler front	elect shop	deck spares	CO2 room	compartment	upper level	cabin	MG room	weather deck	deck locker	unnamed compt.	lounge	Asst. Elect. SR		Ch. Eng. office	messmen SR	wiper SR	hospital	SR	Jr. Asst Eng SR	Chief Eng. SR	Table 14. SHIRLEY LYKES Ventilation System Gaskets Sampling Results
Deck	Nav Bridge	Upper/Focsle	Main	Main	Machinery Space	Machinery Space	Machinery Space	Upper Tween	Upper Tween	Upper Tween	Upper Tween	ace	ridge	Main		Main ser Ber Ber	Main	Upper/Focsle/Winch	Upper/Focsle	Upper/Focsle	Boat/Cabin	Main	Main	Main	Main	Upper/Focsle	Boat/Cabin	Table 14. SHIRLEY I
Results	722	1,500	18,900	4,890	4,820	17,100	6,330	6,780	7,100	8,810	13,620	174	<44	433	<43	1660	<39	1600	13,100	1,210	1,470	1,035	1,162	188	296	<38	<37	
#NSCL#	3	10	48	27	54	53	- 61	65	- 62	64	19	76	5	31	74	44	39	8	19	14	13	33	35	38	41	17	12	
ETSI#	7170	7175	7192	7269	7437	7441	7445	7448	7449	7450	7452	7455	7167	7272	7294	7191	7289	7173	7177	7184	7187	7280	7282	7288	7290	7181	7186	***************************************

Shaded text incidates PCB ≥50 ppm.

74.59 3.7 3.600 Machinery space port side felt, 1/8°, dark brown port side 74.69 4.0 5.000 Machinery space lover level 6.0 port middle 74.7 4.4 5.870 Machinery space lover level 7.0 1.7 felt, 1/8°, dark green port middle 74.7 4.4 5.870 Machinery space lover level 7.0 1.7 felt, 1/8°, dark green port middle 74.9 1.2 5.200 Cabin passageway 1.1 felt, 1/8°, dark green port middle 74.9 1.2 5.490 Cabin passageway 1.1 felt, 1/8°, dark green port middle 74.9 1.6 1.2.30 Boat cabin port side 1.1 felt, 1/8°, dark green port middle 75.0 2.2 3.16 Main cabin shd fr.74 7 felt, 1/8°, dark green port passage at 75.1 2.2 3.30 Main galley stde 1.3 felt, 1/8°, dark green port							
40 5,040 Machinery space starboard side felt, crumbled 43 11,240 Machinery space lower level felt, 18", dark green 14 5,870 Cabin fwd passageway sted 17 felt, 18", dark green 10 5,290 Cabin pssageway 11 felt, 18", dark green 10 9,510 Cabin stod at passageway 11 felt, 18", dark green 13 5,490 Cabin stod at passageway 11 felt, 18", dark green 14 9,480 Boat cabin port side 1 felt, 18", dark green 23 3,116 Main cabin port ft 89 15 felt, 18", dark green 24 3,30 Main galley 7 felt, 18", dark green 55 4,660 Main galley 44 felt, 18", dark green 56 4,660 Main galley 44 felt, 18", dark green 57 4,500 Second galley 44 felt, 116", black		37	3,600	port side		felt, 1/8"., dark brown	port side
43 11,240 Machinery space lower level Felt, 1/8°, dark green 44 5,870 Machinery space lower level 7 felt, 1/8°, dark green 10 5,520 Cabin fewa passageway sthd 17 felt, 1/8°, dark green 10 5,510 Cabin stbd aft passageway 11 felt, 1/8°, dark green 14 9,480 Boat cabin port side 3 felt, 1/8°, dark green 23 3,116 Main cabin stbd ff 74 7 felt, 1/8°, dark green 22 3,300 Main cabin stbd ff 74 7 felt, 1/8°, dark green 52 3,300 Main galley, stbd side 44 felt, 1/8°, dark green 52 3,300 Main galley, stbd side 44 felt, 1/8°, dark green 54 4,660 Main galley, stbd side 44 felt, 1/8°, dark brown 55 4,660 Main galley, stores 16 felt, 1/8°, dark brown 27 4,390 Second		40	5,040	starboard side		felt, crumbled	stbd side
44 5,870 Machinery space lower level 7 felt, gray 12 5,290 Cabin fwd passageway stbd 17 felt, 1/8", dark green 13 5,490 Cabin stbd att passageway 11 felt, 1/8", dark green 14 9,480 Boat cabin port side 3 felt, 1/8", dark green 22 3,390 Main cabin port side 7 felt, 1/8", dark green 22 3,390 Main mess deck 1 felt, 1/8", dark green 51 1,33 Main mess deck 1 felt, 1/8", dark green 52 3,390 Main mess deck 1 felt, 1/8", dark green 51 1,23 Main mess deck 1 felt, 1/8", dark green 54 4,660 Main galley, stbd side 44 felt, 1/6", dark green 54 4,560 Main head port inboard 16 felt, 1/6", dark green 57 4,560 Main port side ladder 1		43	11,240	lower level		felt, 1/8", dark green	port middle
12 \$,290 Cabin fwd passageway stbd 17 felt, 1/8", dark green 10 9,510 Cabin stbd aft passageway 11 felt, 1/8", dark green 16 1,230 Boat cabin port side 3 felt, 1/8", dark green 14 9,480 Boat cabin stbd 1 felt, 1/8", dark green 23 3,10 Main cabin port side 1 felt, 1/8", dark green 24 3,316 Main cabin port fr 89 15 felt, 1/8", dark green 25A 7,330 Main mess deck 37 felt, 1/8", dark green 56 4,660 Main galley, stbd side 44 felt, 1/16", black 57 4,560 Main head port inboard 44 felt, 1/16", dark green 56 4,660 Main palley stores 16 felt, 1/16", black 57 4,500 Main palley stores 16 felt, 1/8", dark green 27 3,910 Second palley stores		44	5,870	lower level		felt, gray	port fwd
10 9,510 Cabin passageway felt, 1/8", dark gray-green 13 5,490 Cabin stbd aft passageway 11 felt, 1/8", dark gray 16 1,230 Boat cabin port side 3 felt, 1/8", dark green 23 3,116 Main cabin stbd ff.74 7 felt, 1/8", dark green 22 3,300 Main ast flat ff.155 37 felt, 1/8", dark green 52 7,330 Main mess deck 1 felt, 1/8", dark green 51 123 Main mess deck 1 felt, 1/8", dark green 54 4,660 Main paalley stores 1 felt, 1/16", black 54 4,780 Main head port inboard 16 felt, 1/16", black 57 4,300 Second galley stores 16 felt, 1/8", dark green 57 4,500 Second port side ladder na felt, 1/8", dark green 57 6,680 Second methinery space 22		12	5,290	fwd passageway stbd	17	felt, 1/8", dark green	
13 5,490 Cabin stbd aft passageway 111 felt 1/8", dark gray 16 1,230 Boat cabin port side 3 felt, 1/8", dark gray 23 3,116 Main cabin port fr 89 15 felt, 1/8", dark green 22 3,390 Main cabin stbd fr 74 7 felt, 1/8", dark green 30 157 Second att flat fr 155 37 felt, 1/8", dark green 51 123 Main galley, stod side 44 felt, 1/16", black 54 4,660 Main head port inboard 44 felt, 1/16", black 54 4,780 Main head port inboard 44 felt, 1/16", black 54 4,780 Main head port inboard 44 felt, 1/16", black 55 6,680 Second galley stores 16 felt, 1/8", brown 27 3,910 Second port side ladder in felt, 1/8", brown 25 6,680 Second port side ladder		10	9,510	passageway		felt, 1/8", dark gray-green	
16 1,230 Boat cabin port side 3 felt, 1/8", dark gray 14 9,480 Boat cabin stbd 1 felt, 1/8", dark green 23 3,116 Main cabin port ft 89 15 felt, 1/8", dark green 22 3,390 Main mess deck 7 felt, 1/8", dark green 52A 7,330 Main mess deck 1 felt, 1/8", dark green 51 123 Main galley, stbd side 44 felt, 1/16", black 56 4,660 Main head port inboard 44 felt, 1/16", dark brown 57 4,780 Main head port inboard 16 felt, 1/8", dark brown 57 4,930 Second galley stores 16 felt, 1/8", dark brown 57 4,930 Second port side ladder na felt, 1/8", brown 23 6,680 Second port side ladder na felt, 1/8", brown 49 673 First Platform engurs. head		13	5,490	stbd aft passageway	-	felt	
14 9,480 Boat cabin stdd 1 felt, 1/8", dark green 23 3,116 Main cabin port ff 89 15 felt, 1/8", dark green 22 3,390 Main at flat ff 155 7 felt, 1/8", dark green 30 157 Second at flat ff 155 37 felt, 1/8", dark green 51 123 Main galley, stbd side 44 felt, 1/16", black 56 4,660 Main lead port inboard 44 felt, 1/16", dark green 57 4,780 Main lead port inboard 44 felt, 1/16", dark green 27 3,910 Second galley stores 16 felt, 1/8", dark green 27 4,930 Second port side ladder 16 felt, 1/8", dark green 25 6,680 Second machinery space 22 felt, 1/8", dark brown 28 503 Main engnrs head 7 felt, 1/8", dark brown 55 felt, 1/8", dark brown		16	1,230	cabin port side	3	felt, 1/8", dark gray	head cnit line
23 3,116 Main cabin port ff 89 15 felt, 1/8", dark green 22 3,390 Main ath flat ff 155 7 felt, 1/8", dark green 30 157 Second ath flat ff 155 7 felt, 1/8", dark green 51 7,330 Main galley, stbd side 44 felt, 1/16", black 56 4,660 Main head port inboard 44 felt, 1/16", dark green 54 4,780 Main head port inboard 44 felt, 1/16", dark green 27 3,910 Second galley stores 16 felt, 1/8", dark brown 27 4,930 Second port side ladder na felt, 1/8", dark green 25 6,680 Second machinery space 22 felt, 1/8", dark brown 28 503 Main engnrs. head 5 felt, 1/8", dark brown 55 felt, 1/8", dark brown felt, 1/8", dark brown	ila,	14	9,480	cabin stbd	_	felt, 1/8", dark green	fwd head
22 3,390 Main cabin stbd ff 74 7 felt, 1/8", dark green 30 157 Second aft flat ff 155 7 felt, 1/16", black 51 123 Main galley, stbd side 44 felt, 1/16", black 56 4,660 Main galley, stbd side 44 felt, 1/16", black 54 4,780 Main head port inboard 44 felt, 1/16", black 57 4,780 Main galley stores 16 felt, 1/16", dark green 57 4,930 Second galley stores 16 felt, 1/8", dark brown 25 6,680 Second machinery space 22 felt, 1/8", dark brown 249 673 First Platform room ff 90-93 5 felt, 1/8", dark brown 58 503 Main head stbd passageway 17 felt, 1/8", dark brown		23	3,116	cabin port fr 89	15	felt, 1/8", dark green	port passage aft
30 157 Second aft flat fr 155 377 felt, 1/8", dark green 52A 7,330 Main galley, stbd side 4 felt, 1/16", black 54 4,660 Main galley, stbd side 44 felt, 1/16", black 54 4,780 Main head port inboard 44 felt, 1/16", black 27 3,910 Second galley stores 16 felt, 1/16", dark brown 25 6,680 Second port side ladder na felt, 1/8", dark brown 25 6,680 Second machinery space 22 felt, 1/8", dark brown 49 673 First Platform room fr 90-93 5 felt, 1/8", dark brown 58 503 Main head stbd passageway 17 felt, 1/8", dark brown		22	3,390	cabin stbd fr 74	7	felt, 1/8", dark green	port inboard head
52A 7,330 Main galley, stbd side 1 felt, 1/16", black 51 123 Main galley, stbd side 44 felt, mottled brown 54 4,660 Main galley 44 felt, 1/16", black 27 3,910 Second galley stores 16 felt, 1/16", dark green 57 4,930 Second galley i6 felt, 1/8", dark green 25 6,680 Second machinery space 22 felt, 1/8", dark green 32A 946 Second machinery space 22 felt, 1/8", dark brown 49 673 First Platform room fr 90-93 5 felt, ark brown 58 503 Main head stbd passageway 17 felt, 1/8", dark brown		30	157	aft flat fr 155	37	felt, 1/8", dark green	
51 123 Main galley, stbd side 44 felt, mottled brown 56 4,660 Main galley 44 felt, 1/16", black 54 4,780 Main head port inboard 4 felt, 1/16", dark green 27 3,910 Second galley stores 16 felt, 1/16", dark brown 25 6,680 Second port side ladder na felt, 1/8", dark green 32A 946 Second machinery space 22 felt, 1/8", dark brown 49 673 First Platform room ff 90-93 5 felt, 1/8", dark brown 58 503 Main head stbd passageway 17 felt, 1/8", dark brown		2A	7,330	mess deck		felt, 1/16", black	
56 4,660 Main galley 44 felt, 1/16", black 54 4,780 Main head port inboard 6th, 1/16", dark green 27 3,910 Second galley stores 16 felt, 1/8", dark brown 25 6,680 Second port side ladder na felt, 1/8", dark green 32A 946 Second machinery space 22 felt, 1/8", brown 49 673 First Platform room ff 90-93 5 felt, 1/8", dark brown 58 503 Main head stbd passageway 17 felt, 1/8", dark brown		51	123	galley, stbd side	4	felt, mottled brown	
54 4,780 Main head port inboard felt, 1/16", dark green 27 3,910 Second galley stores 16 felt, 1/8", dark brown 25 6,680 Second port side ladder na felt, 1/8", dark green 32A 946 Second machinery space 22 felt, 1/8", brown 49 673 First Platform room ff 90-93 5 felt, 1/8", dark brown 58 503 Main head stbd passageway 17 felt, 1/8", dark brown		99	4,660	galley	44	felt, 1/16", black	Territoria de la companya del la companya de la companya del la companya de la co
27 3,910 Second galley stores 16 felt, I/8", dark brown 57 4,930 Second galley 16 felt, charcoal gray 25 6,680 Second port side ladder na felt, I/8", dark green 32A 946 Second machinery space 22 felt, I/8", brown 49 673 First Platform room fr 90-93 5 felt, I/8", dark brown 58 503 Main head stbd passageway 17 felt, I/8", dark brown		54	4,780	head port inboard		felt, 1/16", dark green	The state of the s
57 4,930 Second galley 16 felt, charcoal gray 25 6,680 Second port side ladder na felt, 1/8", dark green 32A 946 Second machinery space 22 felt, 1/8", brown 49 673 First Platform room fr 90-93 5 felt, 1/8", dark brown 58 503 Main head stbd passageway 17 felt, 1/8", dark brown		27	3,910	galley stores	16	felt, 1/8", dark brown	port outboard
25 6,680 Second port side ladder na felt, 1/8", dark green 32A 946 Second machinery space 22 felt, 1/8", brown 49 673 First Platform 5 felt, 1/8", dark brown 58 503 Main head stbd passageway 17 felt, 1/8", dark brown		2.5	4,930	galley	91	felt, charcoal gray	
32A 946 Second machinery space 22 felt, 1/8", brown 49 673 First Platform 5 felt, 1/8", dark brown 58 503 Main engnrs. head Felt, dark brown 55 <17 Main head stbd passageway 17 felt, 1/8", dark brown		25	089*9	port side ladder	na	felt, 1/8", dark green	ladder between main and 2nd deck
49 673 First Platform room ft 90-93 5 felt, 1/8", dark brown 58 503 Main engnrs. head felt, dark brown felt, dark brown 55 <17 Main head stbd passageway 17 felt, 1/8", dark brown		2A	946	machinery space	22	felt, 1/8", brown	
58 503 Main engnrs. head engrs. head 55 <17 Main head stbd passageway 17	1	46	673	room fr 90-93	\$	felt, 1/8", dark brown	switchboard vent gasket
55 <17 Main head stbd passageway 17		28	503	engnrs. head		felt, dark brown	
		55	<17	head stbd passageway	17	felt, 1/8", dark brown	
						•	

Shaded text indicates PCB ≥50 ppm.

											The second secon					10 1 10 10 W														
Comments	door gasket	distribution box gasket	loose rubber 0-ring gasket on work bench	door gasket	door gasket	1	hatch gasket, deck fwd	winch motor port	locker door gasket	light fixture gasket	exhaust fan gasket over fryer	thermal insulation	hot water pipe	pipe insulation on reefer	felt filter, control air compressor	gray, solidified. Pipe thermal penetrator, fwd bulkhd	paint in cans, fwd bulkhead	shower base	elect. stuffing tube caulk	rubber gasket at foot of ladder	pipe hanger, aft bulkhead	rubber spacer on toilet seat	machinery closure, port side	closure gasket		THE PROPERTY AND ADMINISTRATION OF THE PROPERTY OF THE PROPERT	The state of the s			VICTOR OF THE PARTY OF THE PART
Material	foam rubber 1"x1/2"	rubber	solid rubber	foam rubber, 1"x1/2"	cloth inserted rubber	foam rubber	solid rubber, 1/2"x1 1/4"	solid rubber	foam rubber, 1/8"	felt, 1/8"	felt, 1/8", dark gray	foam rubber	lagging cloth	foam rubber	air filter	caulk	paint	water closet grout	caulk	solid rubber, 7/8"x1"	felt, 1/8", dark gray	white rubber	processed cork	processed cork	lio	grease	iio	grease		
Cat.	3	3		3	3	3	3	3	3	4	4	5	5	5	9	7	7	7	7	7	6	01	01	01	=	=	=	=		
Compt. No.	38		14	35	34	33	20	-	20		23	14	61			34	91	16		16	26	2	16	5					4	
Space	dairy room	machinery space	carpenter shop	cargo meat room	fruit & veg room	Able Seaman	compartment fr131	focsle deck	survival gear lkr	Officers Mess	galley	fan room	Officer's laundry	machinery space	machinery space	fruit & veg room	steering gear rm	3rd Asst Eng WC	machinery space	steering gear rm	stbd fuel oil fill sta	Capt's WC	hydraulic pump rm	upper twin	forward windlass	forward windlass	after steering	after steering	fied.	
Deck	Main	Tank top	Second	Main	Main	Poop	Main		Aft House Bridge	Aft House Bridge	Main	Main	Aft House Bridge		Third	Main		Aft House Bridge	Second	Second	Main	Lower Bridge		Second	Main				* Could not be analyzed. Sample extract solidified	** Could not be analyzed. Excessive impurities.
Results	1,092	102	251	432	1,840	<11		<38	<47	1880	<50	478	7	*	<47	2,240	<32	<1	<34	<50	<45	<34	<44	<39		**	<50	*	* Could not be ans	** Could not be an
WSCL#	45	9/	52	48	47	34	63	89	8.	85	41	58	16	83	77	46	51	14	06	20	40	5	19	91	501	106	107	108		
ETSI#	7113	7252	7197	7116	7115	7108	7221	7213	7089	7085	7110	7217	7087	7228	7248	7114	7196	7083	7231	7117	7111	7073	7219	7235	7793	7794	7795	9622		

Shaded text indicates PCB ≥50 ppm.

Table 16. EXPORT CHALLENGER - Other PCB Sample Results

7287 40 155 Main SR 25 3 hard rubber, block sink gasket 7284 37 661 Main EGR Machinery Space 122 3 solid rubber, Tay, 2 waterlijkt door gasket 7206 65 <43 Machinery Space MG Room 7 3 solid rubber, red, I in the ricle 71276 65 <43 Machinery Space MG Room 7 3 cloth inserted rubber red, I in the ricle 71279 68 <44 Main Few Lounge 9 5 fibrus space fibrus space<	EISI#	WISCL#	Kesuits	Deck		Space	_	Compt. 1vo.	Call.	ı ype	Collinents
37 661 Main EDG Room 22 3 solid rubber; I*x1/2" 48 1,332 Machinery Space Throttle Sta 5 3 solid rubber 50 <43	7287	40	155			SR		25	.3	hard rubber, black	sink gasket
48 1,332 Machinery Space Throttle Sta 5 3 solid rubber 69 <43	7284	37		Main		EDG Room		22	3	solid rubber, 1"x1/2"	water tight door gasket
69 <43 Main MG Room 7 3 cloth inserted rubber 22 <50	7300	48	1,332	Machinery Space		Throttle Sta		2	3	solid rubber	red, I inch circle
22 <50 Boat/Cabin Fan Room 14 3 foam rubber, black 49 <39	7276	69	<43	Main		MG Room	-	7	3	cloth inserted rubber	machinery closure
49 <39	7189	22	<50	Boat/Cabin		Fan Room		14	3	foam rubber, black	fan room closure, heavy, black
68 <46 Main Crew Lounge 9 5 fibrous gray insulation 49A <47	7264	49	<39	Upper/Focsle/Wincl		Focsle	_	-	4	felt, 1/8", brown	winch controller closure
49A <47 Machinery Space Reefer Plant 5 5 fiberous insulation 51 <23	7279	89		Main		Crew Lounge		6	5	fibrous gray insulation	from bulkhead
51 <23 Machinery Space At Phone Booth 5 6 fiberous insulation 52 466 Machinery Space Watch Desk 5 7 foam rubber 71 <48	7298	49A	<47	Machinery Space		Reefer Plant		5	5	fiberous insulaiton	cold pipe thermal Insulation
52 466 Machinery Space Watch Desk 5 7 foam rubber 71 <48	7444	51	<23	Machinery Space		At Phone Booth	_	5	9	fiberous insulation	phone booth sound ampening
71 <48 Main Weather Deck 7A 7 stuffing tube caulk 63 <4	7297	52	466	Machinery Space		Watch Desk		5	7	foam rubber	dense, soft, vibration dampening
63 <4 Upper Tween Elect Shop 12 7 paint thinner 45 45 759 Main Boan Stores 1 8 duct tape 25 <22	7274	7.1	<48	Main				7A	7	stuffing tube caulk	hatch 3
45 759 Main Dairy Room 34 8 duct tape 25 <22	7446	63	<4	Upper Tween		Elect Shop		12	7	paint thinner	pasnun
25 <22 Main Bosn Stores 1 8 duct tape 50 <10	7292	45		Main		Dairy Room		34	8	duct tape	silver cloth
50 <10 Machinery Space By Main Engine 5 9 felt 70 <1	7266	25	<22	Main		Bosn Stores	-	-	8	duct tape	red cloth
70 <1 Main Weather Deck 7A 10 black plastic 60 <44	7435	50		Machinery Space		By Main Engine		5	6	felt	pipe hanger liner
60 <44 Machinery Space SWBD 5 10 solid plastic, black 101 <50	7273	70		Main		Weather Deck		7A	01	black plastic	hyd hose, Hatch 3, metal reinforced
101 <50 forward windlass 11 102 * forward windlass 11 103 <50	7432	9	<44	Machinery Space		SWBD		5	10	solid plastic, black	General Electric switch plate cover
102	7789	101	<50		-				=	lio	
103	7790	102	*						=	grease	
104 * after steering 11 * Could not be analyzed. Excessive impurities.	1622	103	<\$0			ufter steering			11	lio	
* Could not be analyzed. Excessive impurities.	7792	104	#			ofter steering			=	grease	THE REAL PROPERTY AND ADDRESS OF THE PROPERTY ADDRESS
			* Could not be a	ınalyzed. Excessive	impurities					de annuel constitue de la cons	American in the control of the contr

Shaded text indicates PCB ≥50 ppm.

Table 17. SHIRLEY LYKES - Other PCB Sample Results

Concentrations of PCBs at or above 50 ppm were found in three of the six categories sampled in WAYNE VICTORY (Table 18).

4.4 NON-PCB SAMPLES

4.4.1 Materials and Results

Other samples were taken to look for asbestos, cadmium, ethylene glycol, freon, lead, mercury, polycyclic aromatic hydrocarbons, and tin (in organo-tin bottom paint). These materials were selected as representative of the types of materials that may be encountered in commercial ships which would have environmental, safety and health consequences.

- Asbestos was tested for in thermal insulation, putty, valve packing, deck tiles, gaskets, electrical insulation, pipe hanger liners, overhead (ceiling) tiles, and caulk. Asbestos results are reported in percent by weight total asbestos in the sample.
- Cadmium was once a common plating material. Samples of metal fasteners were recovered, the surface filed off, and the filings analyzed for total cadmium metal. The results are reported in parts per million cadmium, by weight in the filings.
- Most types of chlorofluorocarbon refrigerants and propellants (freon) will soon be banned because of international treaties. Samples of refrigerants from shipboard cooling systems were taken and analyzed to determine whether freon compounds were present, and if so, what type of Freon was found. R-12 (dichlorodifluoromethane) was the only refrigerant found. Results are reported as R-12 (present).
- Lead was analyzed for in paint, gaskets and joint compound. Results are reported in parts per million, by weight.
- Mercury was tested for in a machinery system liquid level gauge and in some fluorescent light bulbs. Results are reported in parts per million by weight of the fluorescent tube and in parts per billion by weight of fluid recovered from the gauge.
- Organo-tin was once a common antifouling ingredient used in bottom paints on ships. Samples of hull paint from above the waterline were analyzed for tin. Note that when used as an antifouling agent, tin would be present in paint at concentrations of approximately 2% to 4% by weight.

All of the potential contaminants sampled for were found in the ships, except for tin in hull paint. While detectable, the levels of tin are far below those expected in organo-tin antifouling paint. This may be because this paint was not used or because the samples do not represent the bottom paint on the ships. The results for each ship are summarized in Tables 19, 20 and 21.

ETSI#	MSCL#	Results	Deck	Space	Compt. No.	Cat.	Type	Comments
7466	36	140	Machinery space			3	hard rubber	loose gasket and the second se
7478	41	69	Machinery space	lower level, port		5	lagging cloth	thermal insulation, w/paint and adhesive
7497	18	<50	Boat	vestibule	8	5	thermal insulation	port vestibule behind door
7472	52	10,620	Machinery space	lower level		7	caulk in fibrous mat	aft end of boiler casing, starboard
7473	46	653	Machinery space	lower level		7	stuffing tube caulk	black, dried, with paint residues
7487	2	<39	Top of Wheel House	stbd wing		7	stuffing tube caulk	two compounds, one gray, one brown
7517	48	*	Main	storeroom aft flat	33	7	epoxy	galley stores, unused
7518	28	*	Main	storeroom aft flat	33	7	epoxy	galley stores, unused
7496	17	33	Boat	machinery casing	18	6	rubber	stbd side gauge line pipe hanger
7471	45	<41	Machinery space	lower level		10	cloth insert rubber	V belt, aft stbd
7512	53	<47	Main	cabin, port	17	10	solid rubber	port hole deflector (on bunk)
1797	109	<50		after steering		11	lio	
1798	110	<50		after steering		=	grease	
		* Could not be	* Could not be analyzed. Sample extract solidified	solidified.				
				Table 18 WAYNE VICTORY - Other PCB Sample Results	VICTORY -	Other P	CB Sample Recults	
							Common and man of the second	

Shaded text indicates PCB >50 ppm.

ETSI#	WSCL#	Results	Contaminant	Material	Deck	Space
7084	M2	<1%	asbestos	deck tile	Aft House Bridge	3rd Asst Eng SR
7103	M4	35%	asbestos	ceiling tile	Main	crews' rec room
7106	M14	%I>	asbestos	electrical insulation, new	Poop	Messman/QM
7229	M7	%I>	asbestos	putty, vent blower shroud	Second	machinery space
7232	M6	30%	asbestos	loose roll of asbestos cloth	Machinery Space	engine room
7237	M9	85%	asbestos	heat shield	Third	SR 138
7238	M17	85%	asbestos	valve packing	Third	behind boiler
7239	M8	45%	asbestos	loose flexitallic gasket	Third	work bench
7240	M10	40%	asbestos	new valve packing	Third	
7246	MII	<1%	asbestos	pipe hanger liner	Fourth	machinery space
7847	M2	<1%	asbestos	deck tile	Aft house	Engr SR
7244	M18	206 ppm	cadmium	3/4" hex nut	Third	machinery space
7207	M15	%65	ethylene glycol	coolant from heating system	Poop	AB seaman
7208	M3	33%	ethylene glycol	emergency gen coolant	Aft House Top	Emerg Gen Room
7533	M5	R-12	freon	refrigeration system	Main	pantry
7534	M13	R-12	freon	reefer	Third	machinery space
7241	M12	69,900 ppm	lead	peeling paint on vent duct	Second	machinery space
9/0/	M1	24.6 ppm	mercury	flourescent tube	Aft House Bridge	2nd Ofer SR
7225	M16	1100 ppm	PAH*	paint chips	Second	posnu
7535	M19	12.9 ppm	tin	hull paint	Hull	
	* Polycy	* Polycyclic aromatic hydrocarbons	carbons			
				Table 19. EXPORT CHALLENGER Non-PCB Samples	1-PCB Samples	

Ξ	%02	asbestos	overhead tile	Upper focsle	SR fr 146-148 port
M7	25%	asbestos	flexirtallic gasket	Machinery Space	throttle control
M11	55%	asbestos	face flange gasket	Machinery Space	desk
M4	%l>	asbestos	floor tile	Main	galley
M5	<1%	asbestos	mastic adhesve	Main	galley
M3	<1%	aspestos	sound dampening	Main	EDG Room
9W	20%	asbestos	pipe hanger liner	Machinery Space	evaporators
M9	%56	asbestos	valve packing, unused	Machinery Space	workbench
M12	35%	asbestos	caulk	Machinery Space	port throttles
M8	<1%	asbestos	Thermal insulation, hot pipe	Machinery Space	lagging pad
M4	<1%	asbestos	deck tile	Main, galley	
M15	72.5 ppm	cadmium		Machinery Space	foundation bolt
M2	36%	ethylene glycol	cooling system	Main	EDG Room
M13	R-12	freon	A/C Compressors	Machinery Space	A/C plant
M14	*	freon	Reefer Compressor	Machinery Space	reefer plant
M10	2,680 ppm	lead	paint chips	Machinery Space	bilge
M16	2.3 ppm	mercury	Fluorescent light tube	Upper Tween	elect. shop
M17	12.6	organotin (tin)	paint chips	hull	
sample esc	caped, no analysis	performed			
	M11 M4 M8 M8 M9 M12 M12 M13 M14 M14 M16 M16 M17 M17	M1 70% M7 55% M11 55% M4 <1%	70% a 55% a 55% a (1% a	bestos be	bestos overhead tile bestos face flange gasket bestos face flange gasket bestos floor tile bestos sound dampening bestos pipe hanger liner bestos valve packing, unused bestos caulk bestos Gaulk bestos Gooling system freon A/C Compressors freon Reefer Compressor flead paint chips cccury Fluorescent light tube ootin (tin) paint chips

ETSI#	WSCL#	RESULTS	Type	Material	Deck	Space
7457	M6	%55	asbestos	flexitallic gasket on workbench		machinery space
7462	6W	40%	asbestos	stuffing tube putty	Upper flat	mach space, stbd
7479	M8	%08	asbestos	pipe hanger	Upper flat	mach space, stbd
7480	M10	40%	asbestos	steam valve packing	Upper flat	mach space, stbd
7481	M12	<1%	asbestos	main steam line insulation	Upper flat stbd	machinery space
7492	M14	35%	asbestos	cable covering	Cabin	radio room
7514	M3	<1%	asbestos	pipe lagging	Main stbd	fwd cabin
7849		%06	asbestos	packing		
7850		%08	asbestos	bulkhead insulation		A STATE OF THE STA
7851		85%	asbestos	bulkhead insulation		
7852		<1%	asbestos	bulkhead insulation		
7470	M11	18 ppm	cadmium	bolt from port turbine housing		mach space
7531	M5	R-12	freon	refrigerant	Lower flat	machinery space
7468	M13	229 ppm	lead	loose gasket	Upper flat	mach space, port aft
7474	M7	1,160 ppm	lead	boiler paint	Lower flat	mach space, stbd
7522	M2	2,160 ppm	lead	sink drain pipe joint	Main deck	stbd side head
7458	M1	>33 ppb	mercury	gauge	Upper flat	mach space
7532	M17	4.2 ppm	organotin (tin)	hull paint	Hull	
7504	M16	*	PAH*	paint	anchor locker	
	* Polycy	* Polycyclic aromatic hydro	c hydrocarbons			
	V **	** Attempted analyis for	or phenanthrine. Failed	alyis for phenanthrine. Failed due to excessive contamination		and the second s
				Table 21. WAYNE VICTORY Non-PCB Samples	PCB Samples	

This Page Intentionally Left Blank

5.0 CONCLUSIONS

Samples of various materials from EXPORT CHALLENGER, SHIRLEY LYKES, and WAYNE VICTORY were recovered and analyzed for polychlorinated biphenyls and other contaminants. Many samples showed the presence of contaminants at concentrations that will be impacted by environmental, safety and health rules during breaking and recycling of the ships.

There are many differences among the three ships in the types of materials used and the concentrations of potentially hazardous materials present, particularly with regard to PCBs. No pattern emerged that could be called typical of all three ships.

These results show that environmental, safety and health controls will be required during breaking and recycling of these ships, and that each ship presents unique problems. Reference 5 assesses the significance of the results.

This Page Intentionally Left Blank

REFERENCES

- 1. Sampling Plan for WAYNE VICTORY, EXPORT CHALLENGER and SHIRLEY LYKES, September 28, 1995.
- 2. Maritime Administration, Report MA-ENV-820-96003-C, Current and Advanced Technologies for the Ship Breaking/Recycling Industry, July 1997.
- 3. Maritime Administration, Report MA-ENV-820-96003-B, Substantive Law on Environmentally Compliant Ship Breaking/Recycling in the United States, July 1997.
- 4. Maritime Administration, Report MA-ENV-820-96003-A, The Legal Environment for Environmentally Compliant Ship Breaking/Recycling in the United States, July 1997.
- 5. Maritime Administration, Report MA-ENV-820-96003-E, Survey of Ships and Materials, July 1997.
- 6. Maritime Administration, Report MA-ENV-820-96003-F, *The Markets, Cost and Benefits of Ship Breaking/Recycling in the United States*, July 1997.
- 7. Maritime Administration, Environmental Assessment MA-ENV-820-96003, Environmental Assessment on the Sale of National Defense Reserve Fleet Vessels for Scrapping, July 1997.
- 8. EPA Guidance Document, Sampling Ships for PCBs Regulated for Disposal.
- 9. MSCL Inc. letter 95/207 of October 13, 1995 to Tony Baney, EPA.
- 10. EPA letter of October 26, 1995 to Denis Rushworth, MSCL Inc.

This Page Intentionally Left Blank

APPENDIX A DESCRIPTION OF CABLE SAMPLES

	EXPORT CHALLENGER		
ETSI #1	Sample Description	\mathbf{D}^2	P ³
7068	Two conductors. Copper armor. Two-layer outer insulation of black plastic wrapping over black plastic. One-layer plastic insulation on each conductor. White filler.	1/2	5
7069	Microwave (RADAR) guide tube. No armor. Black plastic outer insulation. Heavy fabric inner layer.	1	2
7071	Two conductors. Copper armor. Two-layer outer insulation of black plastic wrapping over black plastic. One-layer plastic insulation on each conductor. White filler. Same as 7068.	1/2	5
7072	Three conductors. No armor. Black plastic outer insulation. One-layer plastic insulation on each conductor. Wrapping surrounds filler.	3/8	6
7074	Nineteen conductors. No armor. Gray plastic outer insulation. One-layer plastic insulation on each conductor. No filler.	1/2	20
7077	Two conductors. Gray metal armor. Two-layer outer insulation of black wrapping over black plastic. Two-layer insulation on each conductor of black plastic wrapping over fabric inner wrapping. Salmon-colored, putty-like filler.	1/2	8
7078	Seven conductors. Copper armor. Black plastic outer insulation. Two-layer insulation on each conductor; fabric over plastic. Wrapping surrounds filler.	3/4	17
7088	Two conductors. Bronze armor. Black plastic outer insulation. Inner conductors coated with white plastic and black wrapping. Brown fibrous filler. Same as 7104.	3/8	7
7094	Two conductors. Gray metal armor. All fabric construction. Fabric outer insulation, fabric filler, fabric insulation on each conductor.	1/2	4

	EXPORT CHALLENGER		
ETSI #1	Sample Description	\mathbf{D}^2	P ³
7095	Two conductors. Gray metal armor. All fabric construction. Fabric outer wrapping. Single fabric wrapping on each conductor. Wrapping surrounds filler. Same as 7099.	1/2	4
7097	Three conductors. Copper armor. Two-layer outer insulation; black wrapping over black plastic. Two-layer insulation on each conductor. Wrapping surrounds filler.	1/2	10
7099	Two conductors. Gray metal armor. All fabric construction. Fabric outer wrapping. Single fabric wrapping on each conductor. Wrapping surrounds filler.	1/2	4
7104	Two conductors. Bronze armor. Black plastic outer insulation. Each conductor coated with white plastic and black wrapping. Brown fibrous filler.	3/8	7
7198	Two conductors. Bronze armor. Black plastic outer insulation. Each conductor coated with white fabric over white plastic. Filler.	1/2	7
7200	Two conductors. Copper armor. Black fabric outer insulation. Two-layer insulation on each conductor; black plastic outer insulation over fabric. Filler.	3/8	7
7201	Two conductors. No armor. Black wrapping over black plastic outer insulation. Black fabric over white plastic on each conductor. Black wrapping surrounds filler. Same as 7227	3/8	8
7202	One conductor. No armor. Two-layer outer insulation; black wrapping over black plastic. Fabric coating over inner white plastic coating. Filler imbedded within the wires of the conductor.	3/8	5

	EXPORT CHALLENGER				
ETSI #1	Sample Description	\mathbf{D}^2	P ³		
7203	One conductor. No armor. Woven fabric insulation. No filler.	1/4	1		
7204	Two conductors. Copper armor. Two layer outer insulation; black wrapping over black plastic. Each conductor coated with white plastic with separate wrapping. Wrapping surrounds filler.	1/2	8		
7205	Two conductors. Bronze armor. Black plastic outer insulation. White plastic insulation on inner conductors. Filler. Same as 7206.	3/8	5		
7206	Two conductors. Bronze armor. Black plastic outer insulation. White plastic insulation on inner conductors. Filler.	3/8	5		
7212	Three conductors. Copper armor. Exterior fabric wrapping around plastic outer insulation. Two fabric wrappings around each conductor. Wrapping surrounds filler. Waxy impregnant throughout.	1 7/8	10		
7215	One conductor. No armor. Battery cable. Black tape over black plastic outer insulation. No filler.	1/2	2		
7220	Three conductors. Wrapped fabric-like black outer insulation. Fabric-like wrapping around each conductor. Gray filler. Waxy impregnant.	1 7/8	10		
7222	Three conductors. Copper armor. Two-layer outer insulation; black wrapping over black plastic. Three-layer insulation on each conductor. Wrapping surrounds filler.	2	13		
7224	Three conductors. Copper armor. Black plastic outer insulation. Two-layer insulation on each conductor; fabric over plastic (one white, one black, one red). Wrapping surrounds filler. Same as 7226.	5/8	9		

EXPORT CHALLENGER				
ETSI #1	Sample Description	\mathbf{D}^2	P ³	
7226	Three conductors. Copper armor. Black plastic outer insulation. Two-layer insulation on each conductor; fabric over plastic (one white, one black, one red). Wrapping surrounds filler.	5/8	9	
7227	Two conductors. No armor. Black wrapping over black plastic outer insulation. Black fabric over white plastic on each conductor. Black wrapping surrounds filler.	3/8	8	
7230	Three conductors. Copper armor. Two-layer outer insulation; black wrapping over black plastic. Two-layer insulation on each conductor; black fabric over white fabric. White fabric wrapping surrounds filler.	1 1/4	10	
7243	Three conductors. Copper armor. Two-layer outer insulation; black wrapping over black plastic. Three layer insulation on each conductor; black fabric outer layer, color coded fabric middle layer, white plastic inner layer. White fabric wrapping surrounds filler. May be the same as 7249 but diameter appears larger.	1 1/4	13	
7245	12 conductors. Copper armor. Two-layer outer insulation; black wrapping over gray plastic. Two-layer insulation on each conductor; fabric over plastic. White fibrous filler.	1	27	
7247	Two conductors. No armor. Black wrapping over black plastic outer insulation. Black fabric over white plastic on each conductor. Black wrapping surrounds filler. Same as 7227.	3/8	8	
7249	Three conductors. Copper armor. Two-layer outer insulation; black wrapping over gray plastic. Three layer insulation on each conductor; black fabric outer layer, color coded fabric middle layer, white plastic inner layer. Three different fibers used in filler. Wrapping surrounds filler.	1	13	

	EXPORT CHALLENGER				
ETSI #1	Sample Description	\mathbf{D}^2	P ³		
7251	Three conductors. Copper armor. Two-layer outer insulation; black wrapping over gray plastic. Each conductor has three layer insulation; black fabric outer layer, color coded fabric middle layer, white plastic inner layer. Three different fibers used in filler. Wrapping surrounds filler. Same as 7249.	1	13		

The ETSI chain-of-custody number.
 The diameter of the cable in inches.
 The number of different nonmetallic parts in the cable.

	SHIRLEY LYKES				
ETSI #1	Sample Description	\mathbf{D}^2	P ³		
7166	One conductor. No armor. Internal electric shield around single small conductor. One-layer outer plastic insulation. Inner plastic insulation.	3/8	2		
7168	Eight conductors. Copper armor. Two-layer black plastic outer insulation. Three-layer insulation on each conductor. Wrapping surrounds white fibrous filler. Same as 7433.	3/4	28		
7169	Two conductors. Bronze armor. Two-layer outer insulation. Two-layer insulation on each conductor. Wrapping surrounds filler. Same as 7178.	3/8	8		
7174	Two conductors. Bronze armor. Two-layer outer insulation. Wrapping surrounds filler. Two-layer insulation on each conductor. Same as 7265.	1/2	8		
7176	Two conductors, telephone handset cable. Outer black insulation. Fibrous filler. One-layer plastic insulation on each conductor.	1/4	4		
7178	Two conductors. Bronze armor. Two-layer outer insulation. Two-layer insulation on each conductor. Wrapping surrounds filler.	3/8	8		
7179	Two conductors. Bronze armor. Two-layer outer insulation. Two-layer insulation on each conductor. Wrapping surrounds filler. Same as 7178.	3/8	8		
7182	Two conductors. Gray metal armor. Two-layer outer insulation. Wrapping surrounds filler. Two-layer insulation on each conductor. Filler is two different materials; one brown fiber, one white fiber.	3/8	9		
7185	Three conductors. No armor. Gray outer insulation. One-layer plastic insulation on each conductor. Wrapping surrounds filler.	1/4	6		
7188	Two conductors. Bronze armor. Two-layer black plastic outer insulation. Two-layer insulation on each conductor.	1 3/4	8		
7193	Three conductors. Two-layer plastic outer insulation. Three layer insulation on each conductor. Wrapping surrounds filler.	7/8	13		

	SHIRLEY LYKES		
ETSI #1	Sample Description	\mathbf{D}^2	P ³
7265	Two conductors. Bronze armor. Two-layer outer insulation. Two-layer insulation on each conductor. Wrapping surrounds filler.	1/2	8
7267	One conductor. Gray metal armor. Internal electric shield around single small conductor. One layer outer plastic insulation. One-layer inner plastic insulation.	3/8	2
7268	Two conductors. Bronze armored. Two-layer plastic outer insulation. All internal non-metals are fabric. Two-layer fabric insulation on each conductor. Fabric wrapping surrounds fibrous filler.	1 3/4	8
7270	Two conductors. Bronze armor. Two-layer black plastic outer insulation. Two layer insulation on each conductor. White fibrous filler.	1 7/8	7
7271	Three conductors. Bronze armor. Two layer gray plastic outer insulation. Two-layer insulation on each conductor; fabric wrapping over plastic. Black wrapping surrounds white fabric filler. Same as 7283.	1/2	10
7275	Two conductors. Gray metal armored. Two-layer outer insulation; wrapping over gray plastic. Two-layer insulation on each conductor; heavy fabric over thin black plastic. Wrapping surrounds inner filler.	7/8	8
7281	Two conductors. Bronze armor. Two-layer outer insulation. Two-layer insulation on each conductor. Wrapping surrounds filler. Same as 7265.	1/2	8
7283	Three conductors. Bronze armor. Two layer gray plastic outer insulation. Two-layer insulation on each conductor; fabric wrapping over plastic. Black wrapping surrounds white fabric filler.	1/2	10
7291	Three conductors. No armor. One-layer outer plastic insulation. One-layer plastic insulation on each conductor. Fibrous filler.	3/8	5
7293	Thirty conductors. Bronze armor. One-layer plastic outer insulation. Wrapping surrounds fibrous filler. Three-layers plastic insulation on each conductor.	1 3/8	93

	SHIRLEY LYKES				
ETSI #1	Sample Description	\mathbf{D}^2	P ³		
7295	Three conductors. Bronze armor. Two layer gray plastic outer insulation. Two-layer plastic/fabric insulation on each conductor. Black wrapping surrounds white fabric filler. Same as 7283.	1/2	10		
7431	Two conductors. Bronze armor. Two-layer outer insulation. Wrapping surrounds filler. Two-layer insulation on each conductor. Same as 7265.	1/2	8		
7433	Eight conductors. Bronze armor. Two-layer black plastic outer insulation. Three-layer insulation on each conductor. Wrapping surrounds white fibrous filler.	3/4	28		
7436	Three conductors. Bronze armor. Two layer gray plastic outer insulation. Two-layer plastic/fabric insulation on each conductor. Black wrapping surrounds white fabric filler. Same as 7283.	1/2	10		
7440	Three conductors. Bronze armor. Two-layer outer insulation. Two-layer plastic insulation on each conductor. Wrapping surrounds filler.	1/2	10		
7442	Thirty conductors. Bronze armor. One-layer plastic outer insulation. Wrapping surrounds fibrous filler. Three plastic layers on each conductor. Same as 7293.	1 3/8	93		
7451	Two conductors. Bronze armor. One-layer outer insulation. Two-layer plastic/fabric insulation on each conductor. Fabric wrapping surrounds fibrous filler.	1/2	7		
7453	Four conductors. Bronze armor. One-layer outer insulation. Two layer insulation on each conductor. Wrapping surrounds filler.	1/2	11		
7454	Two conductors. Bronze armor. Two-layer outer insulation. Two-layer insulation on each conductor. Wrapping surrounds filler. Same as 7178	3/8	8		

The ETSI chain-of-custody number.
 The diameter of the cable in inches.
 The number of different nonmetallic parts in the cable.

WAYNE VICTORY				
ETSI #1	Sample Description	\mathbf{D}^2	P ³	
7460	Two conductors. Rusted steel armor. Wrapping over lead cover. Two-layer insulation on each conductor; fabric over plastic Wrapping over fibrous filler. Same as 7488.	5/8	7	
7461	Two conductors. Rusted steel armor. Wrapping over lead cover. Two-layer insulation on each conductor; fabric over plastic. Wrapping over fibrous filler. Same construction as 7488, but larger.	1 1/4	7	
7463	Two conductors. Rusted steel armor. Wrapping over lead cover. Two-layer insulation on each conductor; fabric over plastic Wrapping over fibrous filler. Same construction as 7488, but larger.	3/4	7	
7464	One conductor. No armor. Outer plastic wrapping over outer fabric insulation. Thin plastic wrapping over conductor.	7/8	3	
7465	One conductor. No armor. Outer plastic wrapping over outer fabric insulation. Thin plastic wrapping over conductor. Same construction as 7464, with smaller diameter conductor.	1/2	3	
7467	Three conductors. Bronze armor. Fabric wrapping over lead cover. Fabric wrapping over plastic insulation on each conductor. Wrapping around fibrous filler.	3/4	9	

	WAYNE VICTORY		
ETSI #1	Sample Description	\mathbf{D}^2	P ³
7475	Three conductors. Bronze armor. Fabric wrapping over lead cover. Fabric wrapping over plastic insulation on each conductor. Wrapping around fibrous filler. Appears to be the same as 7467, but sample is too disrupted for good identification.	3/4	9
7482	Six conductors. Rusted steel armor. Fabric wrapping over lead cover. Two fabric wrappings over plastic insulation on each conductor. Wrapping over fibrous filler.	5/8	15
7484	Six conductors. Rusted steel armor. Fabric wrapping over lead cover. Two fabric wrappings over plastic insulation on each conductor. Wrapping over fibrous filler. Same construction as 7482, but larger.	7/8	15
7485	Twenty four conductors. Rusted steel armor. No lead cover. Plastic outer insulation. Two-layer insulation on each conductor. Wrapping around fibrous filler.	7/8	51
7486	Two conductors. Rusted steel armor. Wrapping over lead cover. Two-layer insulation on each conductor; fabric over plastic. Wrapping over fibrous filler. Same as 7488.	5/8	7
7488	Two conductors. Rusted steel armor. Wrapping over lead cover. Two-layer insulation on each conductor; fabric over plastic. Wrapping over fibrous filler.	5/8	7
7489	Three conductors. Extension cord. No armor. Black plastic outer insulation. One-layer plastic insulation on each conductor. White paper wrapping around gray paper filler.	1/4	6
7490	Two conductors. Rusted steel armor. Two-layer outer plastic insulation. One-layer plastic insulation on each conductor. Fibrous filler. Same as 7508.	5/8	5

WAYNE VICTORY					
ETSI #1	Sample Description	\mathbf{D}^2	P ³		
7495	Two conductors. Rusted steel armor. Plastic wrapping over lead cover. Two-layer insulation on each conductor. Fibrous filler.	1 1/8	7		
7502	Two conductors. Shielded coaxial. One layer outer black plastic insulation. Metallized film shield. One-layer plastic insulation on each conductor. Filler.	1 1/16	5		
7503	Two conductors. Rusted steel armor. Two-layer outer plastic insulation. One-layer plastic insulation on each conductor. Fibrous filler. Same as 7508.	5/8	5		
7505	Two conductors. Rusted steel armor. Two-layer outer plastic insulation. One-layer plastic insulation on each conductor. Fibrous filler. Same as 7508.	5/8	5		
7506	Two conductors. Rusted steel armor. Two-layer outer plastic insulation. One-layer plastic insulation on each conductor. Fibrous filler. Same as 7508.	5/8	5		
7508	Two conductors. Rusted steel armor. Two-layer outer plastic insulation. One-layer plastic insulation on each conductor. Fibrous filler.	5/8	. 5		
7513	Two conductors. Rusted steel armor. No lead cover. One-layer plastic outer insulation. Fabric wrapping on waxy fibrous filler. One layer insulation on each conductor.	3/8	5		
7516	Two conductors. Rusted steel armor. Wrapping over lead cover. Two-layer insulation on each conductor; fabric over plastic Wrapping over fibrous filler. Same as 7488.	5/8	7		
7524	Two conductors. Rusted steel armor. Wrapping over lead cover. Two-layer insulation on each conductor; fabric over plastic Wrapping over fibrous filler. Same as 7488.	5/8	7		

WAYNE VICTORY				
ETSI #1	Sample Description	\mathbf{D}^2	P ³	
7526	Three conductors. Rusted steel armor. Fabric wrapping over lead cover. Two-layer insulation on each conductor. Wrapping around fibrous filler.	1 1/4	9	

The ETSI chain-of-custody number.
 The diameter of the cable in inches.
 The number of different nonmetallic parts in the cable.

does not permit return of items for replacement will

Reproduced by NTIS

National Technical Information Service Springfield, VA 22161

This report was printed specifically for your order from nearly 3 million titles available in our collection.

For economy and efficiency, NTIS does not maintain stock of its vast collection of technical reports. Rather, most documents are printed for each order. Documents that are not in electronic format are reproduced from master archival copies and are the best possible reproductions available. If you have any questions concerning this document or any order you have placed with NTIS, please call our Customer Service Department at (703) 487-4660.

About NTIS

NTIS collects scientific, technical, engineering, and business related information — then organizes, maintains, and disseminates that information in a variety of formats — from microfiche to online services. The NTIS collection of nearly 3 million titles includes reports describing research conducted or sponsored by federal agencies and their contractors; statistical and business information; U.S. military publications; audiovisual products; computer software and electronic databases developed by federal agencies; training tools; and technical reports prepared by research organizations worldwide. Approximately 100,000 new titles are added and indexed into the NTIS collection annually.

For more information about NTIS products and services, call NTIS at (703) 487-4650 and request the free NTIS Catalog of Products and Services, PR-827LPG, or visit the NTIS Web site http://www.ntis.gov.

NTIS

Your indispensable resource for government-sponsored information—U.S. and worldwide

		,	



U.S. DEPARTMENT OF COMMERCE Technology Administration National Technical Information Service Springfield, VA 22161 (703) 487-4650